

BNSF Railway Safety Vision

We believe every accident or injury is preventable. Our vision is that BNSF Railway will operate free of accidents and injuries. BNSF Railway will achieve this vision through:

A culture that makes safety our highest priority and provides continuous self-examination as to the effectiveness of our safety process and performance...

A work environment, including the resources and tools, that is safe and accident-free where all known hazards will be eliminated or safe-guarded...

Work practices and training for all employees that make safety essential to the tasks we perform...

An empowered work force, including all employees, that takes responsibility for personal safety, the safety of fellow employees, and the communities in which we serve.



Train Dispatcher's and Control Operator's Manual

In Effect at 0800
Central, Mountain and Pacific
Continental Time
July 1, 2026

These rules and instructions for train dispatchers and control operators supplement the General Code of Operating Rules (GCOR) and Maintenance of Way Operating Rules (MWOR) and are effective July 1, 2026. All previous instructions are cancelled.

Employees using computerized track warrant control systems and CTC/CAD/TSS systems must be familiar with and are governed by instructions issued concerning those systems.

These rules and instructions are designed to establish uniform methods and practices over the entire system. These rules and instructions must be reviewed frequently and referred to when necessary to ensure compliance.

[TOC Home](#)

Table of Contents

40.0	General Instructions.....	7
40.1	Safety	7
40.1.1	Avoid Dangerous Conditions	7
40.1.2	Computer Systems	7
40.2	Rule Books and Required Documents	7
40.3	Reserved for Future Use.....	7
40.4	Signals / Trackside Warning Detectors / Inspections	8
40.4.1	Red Flags	8
40.4.2	Blue Signal Protection of Workmen ..	8
40.4.3	Overrunning of Stop Signal.....	8
40.4.4	Authority to Pass a Stop Signal	9
40.4.5	Relaying Authority to Pass a Stop Signal	9
40.4.6	Failure of Signals	9
40.4.7	Signal Aspects	10
40.4.8	Crossing Warning	12
40.4.9	Crossing Cut Short or Equipment Activating Crossing Warning Device.	14
40.4.10	Trackside Warning Detector Stops / Reportable Messages	15
40.4.11	Failed / Dragging Equipment Track Inspection	16
40.4.12	Slide Detectors	16
40.4.13	Control System Indications	16
40.5	Informed of Train Movement	16
40.6	TMDS Database.....	16
40.7	Instructions and Authorities	17
40.7.1	Issuing Instructions and Authorities ..	17
40.7.2	Repeated Correctly	18
40.7.3	Relaying Instructions	18
40.7.4	Confirmation of Limits Prior to Granting Authority	18
40.7.5	Information Display	18
40.7.6	Complete Information	18
40.8	Back Up Movements.....	19
40.9	Reverse Movements	19
40.10	Authorizing Return Movement to Detached Portion of Train	19
40.11	Protection of Equipment Left on Main Track / Siding	20
40.12	Inoperative Highly Visible Marker.....	20
40.13	General Orders, General Notices, Dispatcher's Notices & Dispatching Systems Notices	20
40.14	Bad Order Cars	20
40.15	Call Signals	21
40.16	Protection of Trains with Cars Containing PIH/ TIH Materials (Loaded and Residue/Empty).....	21

40.17	Crews Relieved on Hours of Service	21
40.17.1	Transportation of Crews Being Relieved	21
40.17.2	General Track Bulletin for Relief and Short Turn Crews	21
40.18	Knowledge of Territory	21
40.19	Student Dispatcher Evaluations	21
40.20	Operations Testing	22
40.21	Rule Violations	22
40.22	Passenger Train Operation	22
40.22.1	Delays and Reporting	22
40.22.2	Schedules	22
40.22.3	Protection of Passenger Train Loading / Unloading Passengers	22
40.23	On-duty—Dispatchers and Probationary Dispatchers	23
40.24	Hi-Rail Limits Compliance System (HLCS)	24
40.25	Emergency Brake Application—Report to Train Dispatcher	25
40.25.1	Undesired Emergency Application (UDE)	25
40.26	Dimensional Shipments	26
40.27	Smart Mobile Client (SMC)	27
40.28	Trains Performing Work Associated with Track Maintenance.....	29
40.29	Absolute Block Protection	29
40.29.1	Vacant Track Protection	30
40.29.2	Absolute Block Protection from Following Movements	32
40.29.3	Absolute Block Protection in Advance of Train	32

[TOC Home](#)

41.0	General Track Bulletin, Track Warrant and Track Bulletin Restriction Instructions for Train Dispatchers	33	42.0	Track Warrant Control Instructions for Train Dispatchers	43
41.1	Ready for Delivery.....	33	42.1	Issuing Track Warrants	43
41.2	Addresses	34	42.2	Track Warrant Restrictions and Freeform Instructions.....	43
41.2.1	Address Instructions	34	42.3	Trains Occupying Overlapping Limits with Trains	43
41.2.2	Changing Address of General Track Bulletins or Track Warrants	35	42.4	Maintenance of Way in Yard Limits / Restricted Limits.....	44
41.3	Track Bulletin Restrictions in Effect.....	36	42.5	Movement on Another District.....	44
41.3.1	General Track Bulletin Not Received	36	42.6	Protection Against Conflicting Movements.....	44
41.4	Track Bulletin Restrictions in Yards.....	36	42.6.1	Use of "After Arrival"	44
41.5	Delivered to Printer, Fax, or Email	37	42.6.2	Use of "Behind" and "Clear At".....	44
41.5.1	Track Warrant	37	42.7	Adjacent Restricted Track	44
41.5.2	Track Bulletin Restriction	37	42.8	Voiding Track Warrants	45
41.5.3	Delivered to Printer, Fax, or Email and Void.....	37	42.8.1	Voiding Existing Track Warrants	45
41.5.4	Reserved for Future Use	37	42.8.2	Changing Established Track Warrant Limits.....	45
41.6	Reserved for Future Use.....	37	42.8.3	Clear of Main Track.....	45
41.7	Track Warrant / Track Bulletin No Longer in Effect.....	38	42.9	Electronic Delivery of Track Warrant (non-PTC Territory).....	46
41.8	Track Warrant and Track Bulletin Restriction Examples	38	42.10	Electronic Delivery of Track Warrant (PTC Territory).....	47
41.8.1	Timetable, Special Instructions, or General Order Modifications.....	38	42.11	Handwritten Track Warrants.....	47
41.8.2	Suspend Block System Signals per GCOR 9.23	38	42.12	Reserved for Future Use.....	47
41.8.3	Trackside Warning Detectors and Signals	39	42.13	Reporting Clear of Track Warrant that Authorizes Movement	48
41.8.4	Speed Restrictions.....	39	42.14	Releasing Portion of Track Warrant Authority	48
41.8.5	Switches	39	42.15	Overlap Circuits.....	49
41.8.6	Flags Placed Less than Required Distance	39	42.16	Equipment that May Not Shunt the Track (ABS)	49
41.8.7	Whistle Warning Request	39	42.17	Permission to Pass Stop Indication in ABS.....	49
41.8.8	Occupied Outfit Cars are Set Out	40	42.18	Back Over Moves in Double Track Territory.....	49
41.8.9	Track Removed from Service	41	42.19	Protect Open Switch	50
			42.20	CTC Locations	51
			42.21	Specifying Limits	51
			42.22	Maintenance of Way Equipment	51
			42.22.1	Contingent / Behind Authorities	51
			42.22.2	Overlapping Limits with Train.....	51
			42.22.3	Maintenance of Way Equipment Operated as a Train	52
			42.22.4	Form B Track Bulletin Restriction and Crossovers.....	52

[TOC Home](#)

43.0	Track Bulletin Restriction and Track Condition Message Instructions for Train Dispatchers	53
43.1	Reserved for Future Use.....	53
43.2	When Track Bulletin Restriction is Requested ...	53
43.3	Condition Permanent	53
43.4	Overlapping Green Flags.....	53
43.5	Issue Track Bulletin Restriction Verbally	53
43.6	Delivery of Track Bulletins and Directives Electronically via PTC	54
43.6.1	Confirmation of Track Bulletins and Directives Delivered Using PTC	55
43.6.2	Loss of On-Board Information.....	56
43.7	Separating Information—Form C Track Bulletin Restriction and Track Condition Message.....	56
43.8	Delivering Track Bulletin Restrictions.....	56
43.9	Improperly Displayed or Missing Track Flags and Signs	57
43.9.1	Improperly Displayed or Missing Track Flags	57
43.9.2	Improperly Displayed or Missing Roadway Signs.....	57
43.10	Form B Track Bulletin Restriction.....	58
43.10.1	Dual Control Switches within Form B Limits	58
43.10.2	Cutoff Time for Issuance of Form B Track Bulletin Restriction	58
43.10.3	Reserved for Future Use	58
43.10.4	No Overlapping Form B Track Bulletin Restriction Authorities	58
43.11	Permanent Speed Signs in Place	59
43.12	Easily Identifiable Locations.....	59
43.13	Written Instructions	59
43.14	Rules Not in Effect	59
43.15	Void and Reissue	59
43.16	Track Condition Messages.....	59
43.17	Use of Form A, B and C Track Bulletin Restrictions	60
43.18	Delivery of Track Bulletins and Directives Electronically (non-PTC Territory)	60
43.18.1	Confirmation of Track Bulletins and Directives Electronically Delivered (non-PTC Territory)	61

44.0	Instructions for Control Operators	63
44.1	OS Indications on CTC Machine.....	63
44.2	Track Blocks or Restrictive Tags	64
44.3	Track Out of Service	65
44.4	Admit Train to Occupied Siding.....	65
44.5	Equipment that May Not Shunt the Track (CTC or Manual Interlocking).....	65
44.6	Lining Controlled Signals / Switches.....	65
44.7	Hold a Controlled Signal at Stop	65
44.8	Authority to Pass a Stop Signal.....	66
44.8.1	Authority to Pass Stop Indication.....	66
44.8.2	Relaying Authority to Pass a Stop Signal	66
44.8.3	Bridges Protected by Absolute Signals	66
44.9	Control System Equipment	67
44.9.1	Switch Correspondence.....	67
44.9.2	Track Indications.....	68
44.9.3	Local Control / Manual Operation	69
44.9.4	Erratic Signal / Track Line Display	70
44.10	Dual Control Switches / Derails.....	71
44.10.1	“Out of Correspondence” Switches... ..	71
44.10.2	Hand Operation of Dual Control Switches	72
44.10.3	Dual Control Switch / Derail Out of Service or Removed	73
44.10.4	Dual Control Derails.....	73
44.11	Instructions in Release Box.....	73
44.12	Permission for Reverse Movements	73
44.13	Before CTC Is Suspended	73
44.14	Adjacent Restricted Track	74
44.15	Relinquish Control of CTC Machine.....	74
44.16	Protection for Occupied Outfit Cars	74
44.17	Reserved for Future Use.....	74
44.18	Protection of Maintenance of Way in Manual Interlockings	74
44.19	Change of Direction	75
44.19.1	Change of Direction within a Control Point or Manual Interlocking. ..	75
44.19.2	Change of Direction Outside of Control Points or Manual Interlockings.....	75
44.20	Control Tower Emergency Bypass Switches / Devices	75
44.21	Train Entering Track within CTC or Manual Interlocking.....	76
44.22	Reserved For Future Use.....	76
44.23	Locomotive Set Out On Line	76
44.24	Signal Testing Instructions	77

[TOC Home](#)

45.0	Track and Time	79	51.0	Train Dispatcher Records	95
45.1	Recording Non-Computerized Track and Time ..	79	51.1	Maintain Records	95
45.1.1	Extend Time Limits	79	51.2	Retain and Archive	95
45.1.2	Authorized Limits	79	51.3	Initials	95
45.2	Issuing Track and Time	79	51.4	Reserved for Future Use	95
45.2.1	Track and Time Request	79	51.5	Verbal Transmission	95
45.2.2	Protecting Limits and Movement	80	51.6	Numbering	96
45.2.3	Locations Used for Track and Time Issuance	81	51.7	Track and Time No Longer in Effect	96
45.2.4	Granting Track and Time	81	52.0	Dispatcher Train Movement Records	97
45.2.5	Loss of Communication	81	52.1	Current Train Movement Record	97
45.2.6	Reserved for Future Use	81	52.2	Train Movement Record Information	97
45.2.7	CTC Outage (Code Brown)— Issuing Track and Time	82	52.3	Authority Issued and Movement Complete	97
45.3	Joint Track and Time	82	52.4	Transfer to Next Day's Train Movement Record ..	98
45.3.1	Same or Overlapping Limits	82	52.5	Crew Relieved at Other than Designated Terminal	98
45.3.2	Notification of Joint Status	82	52.6	Reserved for Future Use	98
45.4	Reporting Clear	83	52.7	Issue Initial Track Warrant or General Track Bulletin	98
45.5	Releasing Track and Time to Move on Signal Indication	83	52.8	TWC Territory	98
45.6	Switch Lined and Locked	83	52.9	Train Movement Records in TWC Territory Not Protected by a Track Warrant Control Computer System	99
46.0	Reserved for Future Use	83	52.9.1	Track Warrant Void or Reported Clear	99
47.0	Reserved for Future Use	83	52.9.2	Locations Not Shown in Station Column	99
48.0	Switch Control and Monitoring Systems	85	53.0	Track and Weather Conditions	101
48.1	Remote Control Power Switch (RCPS)	85	53.1	Adverse Conditions	101
48.2	Switch Point Monitoring Systems (SPMS)	86	53.1.1	Delivering Notification of Adverse Condition(s)	101
48.3	Track Integrity Warning System (TIWS)	87	53.1.2	Unusual Track Condition	101
49.0	Train Control Systems	89	53.1.3	Unusual Switch Condition	102
49.1	Positive Train Control (PTC) and TWC Plus Territory	89	53.1.4	Track Obstruction	102
49.2	PTC Wayside Repair Instructions	90	53.1.5	High Water / Washout	103
50.0	Train Dispatcher Transfers	91	53.2	Weather Conditions and Monitoring	103
50.1	Responsibilities of Train Dispatcher Being Relieved	91	53.2.1	Delivering Notification of Adverse Weather Conditions	104
50.2	Responsibilities of Relieving Train Dispatcher ..	92	53.3	Snow Removal Equipment	105
50.2.1	Review Instructions	92			
50.2.2	Understand Instructions	92			
50.2.3	Understand Track and Time	92			
50.2.4	Reserved for Future Use	92			
50.2.5	Time and Sign	93			

[TOC Home](#)

54.0	Rules For New Westminster Dispatchers	106
54.1	Rules and Instructions.....	106
54.1.1	Terms (CROR Definitions)	106
54.2	Review Email	106
54.3	Daily Operating Bulletins (CROR 156).....	106
54.4	Limits of Authority (CROR 82).....	106
54.5	Authority Form.....	107
54.5.1	Authority to Pass Stop Signal (CROR 564).....	108
54.5.2	Locally-Controlled Interlocking Signal Indicating Stop (CROR 609) ..	108
54.5.3	Permission to Enter Main Track (CROR 568).....	109
54.5.4	Work Authorities (CROR 566).....	109
54.5.5	Joint Work Authorities (CROR 567) ..	109
54.6	Track Occupancy Permit (TOP)	110
54.6.1	TOP Work Authorities (CROR 849) ..	111
54.6.2	Joint TOP Work Authorities (CROR 857).....	111
54.6.3	Follow-up TOP (Behind Train) (CROR 862).....	111
54.7	Crossing Warning (CROR 103(g) and CROR 103.1)	112
55.0	Reserved for Future Use.....	113
56.0	Reserved for Future Use.....	113
57.0	Reserved for Future Use.....	113
58.0	Reserved for Future Use.....	113
59.0	Reserved for Future Use.....	113
60.0	Emergency Response Requirements	114
60.1	Emergency Events	114
60.1.1	Report to ROCC (BNSF Police) and Chief Dispatcher	115
60.1.2	Report to Service Interruption (SID) and Chief Dispatcher	115
60.1.3	Hazardous Materials.....	116
60.2	Earthquake Instructions for Train Dispatchers in Addition to System Special Instructions	117
60.3	Serious Accidents Involving the Integrity of the Block System	117
60.4	Reserved for Future Use.....	117
60.5	Positive Protection	118
60.6	ROCC Request for Traffic Stop.....	118

40.0 General Instructions

40.1 Safety

Safe work practices are the most important aspects of the Train Dispatcher / Control Operator profession. Do not take short cuts that will impact the safe performance of your duties.

All unsafe or unusual conditions are to be reported to the appropriate Chief Dispatcher / Local Supervisor.

40.1.1 Avoid Dangerous Conditions

Set up conditions that provide for the safe movement of trains, engines, and MW equipment. Deviation from any rule or accepted safe practice is not acceptable.

40.1.2 Computer Systems

Enter or select only correct information when utilizing computer systems. Do not tamper or modify BNSF computer equipment.

40.2 Rule Books and Required Documents

A current copy (printed or electronic) of the following documents must be maintained at each position:

- General Code of Operating Rules (GCOR).
- Train Dispatcher's and Control Operator's Manual (TDCOM).
- Maintenance of Way Operating Rules (MWOR).
- Timetable.
- System Special Instructions.
- Employee Safety Rules.
- Air Brake and Train Handling Rules.
- US Hazardous Material Instructions for Rail.
- Emergency Response Guidebook.
- Passenger Train Emergency Preparedness Plan (for dispatching districts that handle passenger trains).

40.3 Reserved for Future Use

40.4 Signals / Trackside Warning Detectors / Inspections

40.4.1 Red Flags

A train dispatcher may not grant permission for a train to pass a red flag. A train dispatcher may relay information regarding passing a red flag from the employee in charge of the red flag.

40.4.2 Blue Signal Protection of Workmen

When a request is received to protect a Mechanical Department employee by providing blue signal protection on a track into which access can be gained through dual control switches, line the switches to prevent entry to the track and apply switch blocks to these switches and apply track blocks to the protected track.

A train dispatcher/control operator must not provide blue signal protection on a Main Track, unless permitted by General Order, Special Instructions or Dispatcher's Notice.

Exception to Providing Blue Signal Protection on Main Track:

Mechanical department employees will request track block from the train dispatcher for blue signal protection on a Main Track when:

- The mechanical employee does not have blue signals,
- or
- Either or both ends of the train are not accessible for the mechanical employee to place blue signals (Example: bridge or topographical reasons prevent accessibility).

Before advising the mechanical employee that track block(s) are applied the train dispatcher must:

- Confirm with the mechanical employee if one or neither end of the train is blue signaled.
- Apply track block(s) to prevent other trains from being authorized into the affected area from the direction that a blue signal(s) cannot be displayed, shortening authorities as necessary.
- Instruct any other trains or MW employees already authorized within the limits occupied by the affected train where blue signal is not displayed to Stop. Obtain confirmation when stopped.

Recording Instructions:

After required dual control switch positioning and/or track or switch blocks have been applied, make entry on the form provided.

Protection is to be issued using the following format:

(Employee name) is granted blue signal protection on (track).

When the Mechanical Department employee completes work and releases the protection, make entry on the form provided.

40.4.3 Overrunning of Stop Signal

When a signal is disregarded or it is suspected a train has overrun a Stop indication:

- Provide protection against trains that may be approaching the location where adjacent tracks or conflicting routes may be fouled.
- Notify the Chief Dispatcher of the facts.
- Hold the train until the Chief Dispatcher provides handling instructions.

In the event of a train overrunning a Stop signal, and the train will be allowed to proceed, authorize the train to proceed using the same verbal format as outlined in GCOR 9.12.1 (CTC Territory), 9.12.2 (Manual Interlockings) or TDCOM 42.17 (Permission to Pass Stop Indication in ABS), as applicable.

40.4.4 Authority to Pass a Stop Signal

Before granting a train authority to pass a signal displaying a Stop indication, as outlined in GCOR 9.12.1 (CTC Territory) and 9.12.2 (Manual Interlockings):

- If Stop indication governs movement through an interlocking or onto an adjoining territory, job brief with the adjoining train dispatcher, control operator, or foreign line operator by phone or CAD IM to:
 - Establish a common understanding of the movement.
 - Request protection on adjoining territory (if necessary).
- Verify from the train crew that the Stop indication is visible.
- Block switches and derails to prevent movement requests. Maintain blocking until movement has completely fouled the control point.
- Apply track block or restrictive tag on the track segment beyond the affected control point and maintain until all trains authorized under provisions of GCOR 9.12.1 or 9.12.2 have occupied the track segment beyond the affected control point, and have:
 - Received a Proceed signal at the next control point,
 - Occupied the next control point,or
 - Reached the end of CTC or Manual Interlocking limits.

Exception: Track block or restrictive tag not required when the next track segment beyond the affected control point is occupied by equipment to be handled.

Authorize trains to pass Stop indications one signal at a time.

40.4.5 Relaying Authority to Pass a Stop Signal

When direct radio communication is possible, do not allow another employee to relay the authority to pass a signal displaying a Stop indication. When another employee must relay this information, the employee must be qualified on the General Code of Operating Rules.

40.4.6 Failure of Signals

Immediately notify the Signal Call Desk and request signal maintainer or signal supervisor notification when block system fails or any of the following are missing:

- Fixed signals.
- Signal appliances.

When fixed signals fail or are missing:

- Apply track block(s) or restrictive tag(s) to the affected area.
- Issue instructions to approaching trains in the following format:

Signal (location or number) reported not working as intended and must be regarded as displaying its most restrictive indication.

In single track ABS territory, address the instructions listed above to trains moving in the opposite direction, covering the next opposing signal beyond the signal reported not working as intended. This will assure that all movements in both directions within the affected block are at Restricted Speed.

Keep these instructions in effect until signal conditions are corrected, and all functions of the signal system are normal.

40.4.7 Signal Aspects

A. Potential False Proceed

When notified that a signal displays a more favorable aspect than it should, determine if it meets the criteria of a potential false Proceed. Examples of a potential false Proceed signal include:

- A signal fails to display its most restrictive indication into a known occupied block.
- A signal indicates Proceed over an out-of-correspondence switch or moveable bridge.
- If two successive signal aspects are observed at the same time and a signal more favorable than Approach (yellow) precedes a Stop indication (red absolute) or Restricting signal (red intermediate).
- If two successive signal aspects are observed at the same time and a signal more favorable than Approach Restricting (yellow over lunar or yellow over flashing red) precedes a Restricting signal (flashing red or lunar).
- Signal indication in the field does not coincide with switch position. (Example: signal indication is for movement in normal position, but switch is actually reversed).

When it has been determined that a potential false Proceed exists, do the following (if determined to not be potential false Proceed see B below):

- Immediately require train movements in the affected area to stop.
- Apply signal blocks to signals governing access to the affected signal at adjacent control points in all directions or use restrictive tags or track blocks in areas that would prevent signals at adjacent control points from clearing into limits. (Note: Do not use switch blocks, recall, or resend within these limits).
- Promptly notify the Chief Dispatcher.
- Promptly notify the Signal Call Desk. Be governed by instructions received or as directed by Corridor Superintendent or NOC GDT.
- Prohibit train movements in the affected area until the signal system has been tested by the signal team and has been released for normal operation by Signal Supervisor (or their designee) or further instructions are received from General Superintendent Transportation (or their designee).

Within CTC limits, when Signal Supervisor (or their designee) has given approval, the train dispatcher may route traffic onto another track until repairs are made, if the affected signal is located at the switch accessing the other track, and it displays a proper aspect when lined for the other track. Unless the reason or conditions surrounding a change of signal indication are definitely known, do not speculate with train crews as to the reason for the change.

B. Improper Signal Sequence—Other Than Potential False Proceed

When notified that a signal displays a more favorable aspect than it should and it does not meet the criteria of a potential false Proceed as shown in the examples listed in section A (Example: crew reports green signal in advance of a red signal but were unable to see both signals at same time), do the following:

- Verify the block ahead of the Stop (red absolute) or Restricting signal (red intermediate, flashing red or lunar) is unoccupied.
 - If unoccupied, reporting crew may be instructed to operate according to signal indication or may be verbally authorized to continue movement if unable to stop before passing a Stop indication in CTC territory.
- Apply signal blocks to signals governing access to the affected signal at adjacent control points in all directions or use restrictive tags or track blocks in areas that would prevent signals at adjacent control points from clearing into limits. (Note: Do not use switch block, recall, or resend within these limits).
- Determine from the reporting party all known signal information.
(Signal Call Desk will need to know color sequence of signals (aspects), not aspect name or indication).
- Promptly notify the Chief Dispatcher and Signal Call Desk.
 - Signal Call Desk may require trains to move at Restricted Speed between the signal displaying a more favorable aspect than it should and the signal displaying Stop or Restricting while the situation is being investigated. Trains may be verbally instructed to operate at Restricted Speed between the specified locations. Maintain these instructions until released for normal operation by the Signal Department.

C. Report of Red Signal

When notified a signal displays a Stop or Restricting indication and cause cannot be explained by normal operating conditions (Example: a train in the block ahead), notify the Signal Call Desk, NOC MOW Help Desk, and Chief Dispatcher.

Discontinue train movement when signal maintainer and/or section personnel arrive to inspect the condition and immediately give time to inspect the condition unless otherwise advised by on-site signal personnel.

When notified a signal displaying a Proceed indication changes to an indication requiring a train to Stop, as in the case of GCOR 9.6, report the signal change to the Signal Call Desk and Chief Dispatcher.

40.4.8 Crossing Warning

Restrict access to affected crossings and make required notifications to affected trains as follows for:

- Accidents at equipped crossings.
- Reports of malfunctioning crossing warning.
- Reports of crossing warning activation failure/disabled.
- Reports of wayside horn system failure.
- Reports of damaged or missing crossbucks,
or
- Reports of damaged or malfunctioning pedestrian crossing warning.

Promptly restrict access to the crossing as follows:

- When a crossing warning notification is required for crossings located on a Main Track, siding or controlled track not designated as a Main Track, restrict access to the affected crossing using a restrictive "XING" tag.
- When a crossing warning notification is required for crossings located on other than Main Track (Example: industry track, yard track, etc.), restrict access to the affected crossing using a restrictive "INFO" tag and place the crossing warning information on a TCM.
- When a crossing warning notification is issued on a Form C track bulletin restriction, the restrictive tag for the crossing must remain in place until all affected trains have received the Form C. Once all affected trains have received the track bulletin Form C, restrictive tag(s) for the crossing may be changed to non-restrictive, but must remain applied in the control system until the track bulletin Form C is voided.

Fill out, retain and archive the appropriate form when crossing warning notification is conducted verbally, unless crossing warning notification is conducted and logged electronically in the control system.

Note: Unless using SMC XING Tag request, do not rely solely on information sent via Smart Mobile Client regarding crossing warning malfunctions or repairs. If such information is received via Smart Mobile Client messaging system, make contact with the reporting party to confirm information. When a specific track is designated, place track name next to the street name on the XING tag.

Example: Oak St–Main 1 only.

Accidents at Crossings

When an accident occurs at a crossing equipped with an automatic warning device (flashers or gates), promptly contact the Signal Call Desk and request signal maintainer notification. Restrict access and provide notification as outlined below for "Crossing Warning Activation Failure / Disabled" until or unless otherwise instructed by signal personnel.

When an accident occurs at a crossing equipped with a passive warning device (crossbucks, yield sign, Stop sign, etc.), promptly contact the NOC MOW Help Desk and request MW notification to confirm passive warning devices are in place and not damaged. Restrict access and provide notification as outlined in "Damaged or Missing Passive Crossing Warning Devices" until the passive warning devices are confirmed in place, are repaired, or you are otherwise instructed by BNSF personnel at the site.

Crossing Warning Activation Failure/Disabled

When notified that crossing warning system has an activation failure or has been disabled, do the following:

- Notify all affected trains as follows: “Automatic crossing warning device activation failure or disabled at (MP). Stop and protect movement even if devices are seen to be working. Proceed per Rule 6.32.2, Procedure 1.” Include crossing name in notification, if provided.
- Notify the Signal Call Desk if original notification is from another source, unless notified by a signal department employee that the crossing is disabled for specific MW track work.

Maintain this process until a signal department employee advises the crossing warning signals are back in service.

Note: If notified by a qualified employee, such as a signal maintainer or MW foreman, that the crossing will be blocked off from use by vehicular traffic, the crossing warning notification above is not required. In this case, issue a Form C track bulletin restriction stating “Crossing at (MP) is out of service and has been barricaded from use by vehicular traffic” to affected trains.

Malfunctioning Crossing Warning

When notified that crossing warning is malfunctioning (flashers or gates), do the following:

- Notify all affected trains as follows: “Automatic crossing warning device false or partial activation at (MP). Stop and protect movement, unless devices are seen to be working or otherwise instructed. Proceed per Rule 6.32.2, Procedure 2.” Include crossing name in notification, if provided.
- Notify the Signal Call Desk if original notification is from another source.

Do not consider the warning devices to be functioning properly until so notified by a signal department employee.

Note: Unless “Stop and protect” Procedure 1 is specifically requested by the Signal Call Desk, all reports of crossing warning malfunctions from the Signal Call Desk are to be handled as “Malfunctioning Crossing Warning.” If “Stop and protect” Procedure 1 is specifically requested by the Signal Call Desk, handle as “Crossing Warning Activation Failure/Disabled” as outlined above.

Damaged or Malfunctioning Pedestrian Crossing Warning

When notified that pedestrian crossing warning, whether associated with motorist crossing or stand-alone, is damaged or malfunctioning, do the following:

- Notify all affected trains as follows: “Automatic crossing warning device false or partial activation at (MP). Stop and protect movement, unless devices are seen to be working or otherwise instructed. Proceed per Rule 6.32.2, Procedure 2.” Include crossing name in notification, if provided.
- Notify the Signal Call Desk if original notification is from another source.

Do not consider the warning devices to be functioning properly until so notified by a signal department employee.

Damaged or Missing Passive Crossing Warning Devices

When notified that crossbucks, Stop signs, etc. are damaged or missing at crossings not equipped with automatic warning devices, do the following:

- Notify all affected trains as follows: "Passive crossing warning device damaged or missing at (MP). Stop and Protect movement. Proceed per Rule 6.32.2, procedure 3." Include crossing name in notification, if provided.
- Provide notification to the NOC MOW Help Desk in order for MW personnel to investigate and repair the passive crossing warning device.

Failure of Wayside Horn System (WHS)

When notified that Wayside Horn System (WHS) is in failure, do the following:

- Notify all affected trains as follows: "Wayside Horn System (WHS) is in failure at (MP). Proceed sounding whistle signal 5.8.2(7) for crossing regardless of WHS indicator status per Rule 6.32.2, Procedure 4." Include crossing name in notification, if provided.

Maintain this process until a signal department employee advises the WHS is working as intended.

Note: WHS is only in failure if the WHS indicator is flashing but the wayside horn is not sounding as train approaches crossing.

40.4.9 Crossing Cut Short or Equipment Activating Crossing Warning Device

Crossing Cut Short

If notified that cars, engines or equipment are standing less than 250 feet from road crossing or crossing signal circuits, dispatchers must protect the situation until rectified by issuing a Form C stating "Stop and protect movement over crossing at (MP) account crossing cut short."

Equipment Activating Crossing Warning Device

Unless signal department requests Box 1 or Box 2 crossing warning notification, when notified that a train or equipment has occupied a crossing or is in close proximity to a crossing signal circuit causing automatic crossing warning devices to activate for an extended period of time and a remedy is not immediately available, discuss with your supervisor and determine what action, if any, may be taken to clear the circuit. If the crossing is located where a train may approach on an adjacent track, issue Form C stating "Stop and protect movement over crossing at (MP) account crossing circuit activated by standing equipment" until the situation is rectified.

Control System Protection

When a Form C is created for a crossing cut short, or when equipment is activating a crossing device, do the following:

- Protect the condition with a restrictive "XING" tag selecting Box 1 (Stop and protect).
- Once all affected trains have received the Form C track bulletin restriction the restrictive tag for the crossing cut short may be changed to non-restrictive, but must remain applied in the control system until the Form C is voided.

If signal department request for Box 1 or Box 2 crossing warning notification is made after Form C has already been issued, void the Form C and make notifications to affected trains using the Box 1 or Box 2 crossing warning notification.

40.4.10 Trackside Warning Detector Stops / Reportable Messages

Provide prompt notification to the Signal Call Desk of all trackside warning detector (TWD) stops and reportable messages that do not require stops ("integrity failure", "maintenance required", etc.).

Input train delay for detector stops using code "DS", filling all required fields related to the car specifications with correct information.

Hot Bearing or Hot Wheel

When trackside warning detector (TWD) stop is for a hot bearing or hot wheel, do the following:

- If train crew has not established contact with the NOC Detector Desk, promptly contact the NOC Detector Desk and advise them the train's identification, TWD location, and contact radio station so they may coordinate the inspection process as outlined in System Special Instructions, item 8(D). When communicating via electronic messaging system, enough information must be contained in the message to positively identify what the communication is associated to (i.e. train ID, location, etc.).
- Grant permission for the train to depart the inspection location, after receiving confirmation from the NOC Detector Desk that the required TWD inspection has been completed (Note: It is not acceptable for crew member to inform the train dispatcher that the NOC Detector Desk has released train from the inspection).

When report of hot bearing or hot wheel is received from a train crew and condition was not detected by TWD equipment traversed within previous 25 miles, contact the Signal Call Desk to request signal maintainer inspect the TWD equipment.

Wheel Impact Load Detector (WILD)

WILD monitors passing trains for wheel defects, categorized as Level 1 or Level 2. When a train crew receives a Level 1 readout from a WILD the crew will:

- Notify the train dispatcher.
- Stop and inspect the affected car(s).

When a train crew reports they have received a Level 1 readout from a WILD:

- If the train crew has not established contact with the NOC Detector Desk, promptly contact the NOC Detector Desk and advise them the train's identification, WILD location and contact radio tower so the NOC Detector Desk can coordinate the inspection process. When making notification via electronic messaging system, enough information must be included in the message to positively identify what the communication is associated with (i.e. train ID, location, etc.).
- Grant permission for the train to depart the inspection location, only after receiving confirmation from the NOC Detector Desk that the WILD inspection has been completed. (Note: It is not acceptable for crew member to inform the train dispatcher that the NOC Detector Desk has released train from the inspection).

If the train crew reports the WILD gave a message that was incomplete or could not be understood, notify the NOC Detector Desk as instructed above. The NOC Detector Desk will advise the train dispatcher and Chief Dispatcher of the appropriate actions. Be governed by Chief Dispatcher instructions.

Level 2 WILD conditions are not transmitted to the crew. Level 2 is monitored by the detector desk.

40.4.11 Failed / Dragging Equipment Track Inspection

If a train is stopped for a DED alarm or for dragging equipment discovered by inspection, and further inspection finds failed/dragging equipment such as wheels, drawbars or brake rigging, MW personnel must be contacted to conduct an inspection of track in the vicinity of the dragging equipment for potential track damage. Track inspection is not required if dragging equipment is found to be smaller, lighter components such as air hoses or banding.

Unless track damage is evident, it is not necessary to hold train traffic pending MW inspection.

40.4.12 Slide Detectors

When slide detector is out of service or disabled issue a Form A restriction on the designated track, between specific mile posts affected, for 20 MPH passenger and freight. Add the following verbiage in the comments section of the Form A track bulletin restriction to enforce the head end restriction:

“HER Slide detector out of service. Be governed by GCOR 6.21.3.”

Include “Track flags not displayed” in the comments, unless arrangements have been made to display track flags.

40.4.13 Control System Indications

When informed that the lights are flashing or are not illuminated on the Power Off Indicators installed on the side of signal housings at highway crossings, promptly notify the Signal Call Desk and Chief Dispatcher. (Restriction of access and notification of trains is not required in this circumstance, however this indicates commercial power has been lost and the crossing device is using a generator or back up batteries to operate).

If the control system indicates a “power off” condition on the control screen by displaying one or more the following indications, notify the Signal Call Desk and Chief Dispatcher:

PO—Power Off

GN—Generator On

BM—Battery Monitor

If the control system indicates one of the following conditions on the control screen, notify the Signal Call Desk, NOC MOW Help Desk, and Chief Dispatcher:

SF or SLIDE—Slide Fence

HW—High Water

SLUMP—Slump Detector

40.5 Informed of Train Movement

Record calls or finals to terminals in the train sheet record. Include cars of excess dimension and any cars picked up on line. Update or cancel the call or final if it becomes apparent that a train will be 30 minutes or more later than indicated.

40.6 TMDS Database

Notify the Chief Dispatcher when you are made aware of a change to a railroad identifiable point, such as a switch moved, restricted limit/yard limit sign moved, controlled signal moved, or other information, such as siding length, which could change or affect the TMDS database.

40.7 Instructions and Authorities

Before giving information concerning trains or train movements to others, require them to identify themselves and their location. Issue and relay authorities and directives exclusively to employees qualified on the GCOR or MWOR.

40.7.1 Issuing Instructions and Authorities

A. Transmitting Instructions and Authorities

Direct the movement of trains and issue the necessary authority and/or instructions to provide for such movements, planning as far in advance as practical, and take into consideration all details that may affect train operation.

To the extent possible, give priority trains preference, and delay no trains unnecessarily.

Communications must be brief, concise, professional and explicit. Any superfluous conversation and use of terms conflicting with or deviating from those prescribed by the rules must be avoided.

To promote consistency thus eliminating possible misunderstandings, the number "0" is to be pronounced as "ZERO".

Instructions and information issued to employees must not place them in a position requiring or suggesting a rule infraction. If instructions or authorities are not commonly understood, or if there is any doubt concerning the instructions, reissue them until an understanding is reached.

When rules or instructions specify exact wording, use the wording specified.

The use of the terms "all right" or any other word or phrase that might be taken as an affirmative reply to a question must not be used in general conversations.

When issuing authorities or conveying information relating to train movement using the Mobile Radio Access System, follow proper identification and radio procedures as outlined in Chapter 2 of the General Code of Operating Rules.

Do not verbally authorize movement on or onto another train dispatcher's district without job briefing with that train dispatcher.

B. Receiving Restrictions and Instructions

After receiving restrictions, instructions or reports of unusual conditions, do the following:

1. If verbally received, repeat the information received and obtain confirmation that the information repeated is correct.
2. Verbally notify train that appear to be traversing or about to traverse the restriction.
3. After verbally notifying trains that appear to be traversing or about to traverse the restriction, place appropriate restrictive tag(s) to protect speed restrictions and crossing warning conditions to ensure PTC enforcement.

When a condition, such as weather warning, speed restriction, crossing warning malfunction, etc., exists between adjoining train dispatcher/control operator territories, after appropriate restrictive tag(s) are placed and any closely approaching trains are notified of the condition, brief with the adjoining train dispatcher/control operator by phone or CAD IM to establish:

- A common understanding of the condition.
- Who is responsible for notifying which trains.
- How access to the condition will be restricted.

40.7.2 Repeated Correctly

After issuing any instruction or authority, and it has been repeated back correctly, or the OK has been acknowledged, respond with, "That is correct." Verify information repeated by field personnel by comparing their transmission to the system "dialog box" or written records as they repeat the information.

If an employee fails three times to repeat a verbal authority, crossing warning or mandatory directive correctly, end issuance to that employee and report the "3 Strikes" incident to the Chief Dispatcher. Be governed by the Chief Dispatcher's instruction as to further handling.

40.7.3 Relaying Instructions

When direct communication is not available, track authority and instructions regarding movement may be relayed through a qualified employee. (Note: An exception to this rule is MWOR 6.2.1 requirement that direct contact is made between MW employee and train crew when authority is issued behind a train).

Such instructions must be given to the relaying employee who will relay the information to the destination employee. After the destination employee receives the information, it should be repeated to the relaying employee who will then repeat the information to the train dispatcher or control operator and, if correct, the words "OK, the time and dispatcher's initials" should then be relayed in the same manner.

40.7.4 Confirmation of Limits Prior to Granting Authority

Following a verbal request for authority from an operator of on-track equipment or MW employee, the following applies:

- If authority can be granted as requested, restate the limits to requesting employee for confirmation.
- If confirmation is received from the employee, issue the authority with no change in the confirmed limits.
- If unable to grant authority with limits as requested, state limits that can be given, asking employee if usable.
- If changed limits are usable, require the employee to repeat the changed limits to confirm understanding before issuing.

40.7.5 Information Display

When performing functions that require verbal transmission/repetition of information, the appropriate information must be displayed and used to match against the verbal communication in order to verify accuracy.

Examples include transmission of mandatory directives, releasing portion of authority limits, reporting clear of authority limits and restoring Main Track switches through the Protect Open Switch (POS) process.

When information is displayed on the workstation or form is accessed, advise readiness to field employee and restate authority number involved.

If a field employee begins to state information before the appropriate information is displayed on the workstation or form is accessed, do not accept the information. Require that employee to retransmit once the window or information is accessed.

40.7.6 Complete Information

When information is received from a field employee, ensure that the information is complete for the designed process being performed.

Designed processes include issuing and releasing mandatory directives, switch briefings, releasing portion of authority, etc.

40.8 Back Up Movements

Before granting permission for a back up movement place track block or restrictive tag on the track segment where the movement will occur and ascertain from the train crew if additional authority is needed behind the train to accomplish the back up move by asking a crew member the following:

“Do you need additional authority behind your train to accomplish this back up move?”

In addition, where overlapping authorities exist:

- Stop all other trains within the overlapping limits that will be affected by the move.
- Provide protection against conflicting movements.

Do not grant permission for a back up movement where MW authorities exist that will be affected without conducting a job briefing with the MW employee. (Example: if MW authority was granted behind two trains, it would be permissible to allow the first train to back up without job briefing the MW employee, but not the second train).

40.9 Reverse Movements

Before granting permission for a reverse movement where overlapping authorities exist, do the following:

- Stop all other trains within the overlapping limits that will be affected by the move.
- Provide protection against conflicting movements.

40.10 Authorizing Return Movement to Detached Portion of Train

When a train crew leaves part of their train on the Main Track, where a movement may enter the Main Track between the detached portion and the returning portion, as provided by GCOR 6.20 (A), do not verbally relieve the protection. Issue authority to protect the return movement.

40.11 Protection of Equipment Left on Main Track / Siding

Provide protection before allowing a train crew or MW employee to leave equipment on a Main Track or siding without flag protection in the following manner:

CTC or Manual Interlocking

Apply a restrictive tag(s) or track block(s) to the section(s) of track where equipment is left on the Main Track or controlled siding.

Note: If a restrictive tag or track block is not available, set the signals governing entrance to the limits to display Stop indication and apply signal blocks to prevent signals from lining into the limits.

TWC non-signaled and TWC ABS territory

On Main Track do the following:

- Apply track block(s) and restrictive tag(s) to the section(s) of track where equipment is left on Main Track.
- Report the train clear of their track warrant.

On sidings do the following:

- Apply track block(s) where equipment is left on the siding.

Issue authority within the protected limits in the following manner:

- Notify employee being authorized of the location where standing equipment is located.
- Remove track blocks(s) only. Leave restrictive tag(s) in place.
- Issue authority.
- Re-apply track block(s) to the section(s) of track where equipment is left on Main Track.

Granting Authority in Limits with Standing Equipment

Before granting authority to enter any protected limits where equipment has been left standing, notify employee being authorized of the location of the equipment using the following format:

“Equipment on (**track**) between (**MP**) and (**MP**)”

Removing Protection

Remove protection only after receiving verification from field employee(s) that track is confirmed clear of standing equipment.

40.12 Inoperative Highly Visible Marker

Do not allow a train with an inoperative highly visible marker to leave a location when a replacement marker is available or if the location is a repair point for markers.

40.13 General Orders, General Notices, Dispatcher's Notices & Dispatching Systems Notices

General Orders (System & Division), General Notices (System), Dispatcher's Notices and Dispatching Systems Notices are available electronically at each dispatcher's workstation.

Review these documents before commencing each day's work.

40.14 Bad Order Cars

All affected employees must be notified of bad order cars that are not fit to move, or those having safety appliance defects. Consult the Chief Dispatcher before moving such cars.

Notify MW personnel to determine if track inspection is necessary when engines or cars are set out because of flat spots.

40.15 Call Signals

When riding in control compartment of an engine, comply with GCOR 1.47 (C) part 2.

40.16 Protection of Trains with Cars Containing PIH/TIH Materials (Loaded and Residue/Empty)

Provide vacant track protection ahead of and behind trains with cars containing any quantity of IH materials on the de minimis territories identified in System Special Instructions Item 38.

40.17 Crews Relieved on Hours of Service

When train and engine crews are relieved on line because of Hours of Service, do the following:

- Tell the crew that they are relieved and have no further duties with respect to the train.
- Inform the crew of the location where and when their transportation will pick them up.

40.17.1 Transportation of Crews Being Relieved

When necessary to relieve a crew due to Hours of Service, the transportation (van, train, etc.) that will transport the crew to their tie up location must be enroute prior to the crew's HOS expiring.

40.17.2 General Track Bulletin for Relief and Short Turn Crews

When relief and short turn crews are called to relieve a train on line, arrange to furnish these crews with a current general track bulletin (GTB) before they leave their initial terminal, addressed to the train symbol of the train the crew will relieve whenever possible. When issuing a GTB addressed to a symbol other than the train symbol of the train the crew will relieve, tracking of the GTB becomes a manual process as it relates to delivery of track bulletins that go into effect after the GTB was issued. In situations when this GTB must be addressed to a symbol other than the train symbol the crew will relieve, include this information in the transfer.

It is also preferable to have the crews being relieved take their old general track bulletin (GTB) with them and not leave it on the train.

40.18 Knowledge of Territory

Be familiar and stay current with the physical characteristics of territories assigned. When refamiliarization on computer applications or territory is necessary, coordinate with the Chief Dispatcher.

40.19 Student Dispatcher Evaluations

Student train dispatchers who have not completed their probationary period must submit a completed "Student Dispatcher Evaluation Form" to their supervisor at the end of each training shift. Responsibility for delivering a blank form to the train dispatcher providing the training rests with the student dispatcher. Train dispatchers providing training must complete the evaluation form. Review of these evaluations will assist in development of new train dispatchers.

40.20 Operations Testing

The Federal Railroad Administration mandates and requires operations testing of specific groups of railroad employees. Do not divulge information to field personnel about testing activities or any other information that would interfere with or affect the outcome of such tests.

Field officers may employ the use of simulated conditions (Example: malfunctioning crossing warning, speed restriction, etc.) by way of the train dispatcher to test specific groups of railroad employees. This testing process requires approval from the Chief Dispatcher. The train dispatcher must be governed by the rules associated with the simulated process when this testing is being conducted. When operation testing using simulated conditions is complete the field officer or Chief Dispatcher will cancel the condition with the train dispatcher.

40.21 Rule Violations

If it is suspected or becomes apparent that you, another train dispatcher or employees in the field may be involved in a rules violation, immediately report the situation to the Chief Dispatcher.

40.22 Passenger Train Operation

40.22.1 Delays and Reporting

Do not delay passenger trains for freight trains or maintenance work unless approved by the Chief Dispatcher.

Plan work sufficiently in advance to avoid delay to passenger trains while minimizing freight train delays and maximizing maintenance activities.

Report all passenger train delays to the Chief Dispatcher.

40.22.2 Schedules

Keep a current copy of the "BNSF Passenger Train Schedule" at each dispatcher's desk handling passenger trains. A current copy may be obtained from the BNSF Passenger Services Unit. Included in these schedules are all regular passenger trains except the Chicago Division Suburban trains. In addition to the BNSF Passenger Train Schedule, dispatching districts working the Chicago Division must have the current Suburban train schedules at their desk.

When operation of additional passenger trains becomes necessary, or when regular passenger train schedules are changed, notification will be provided sufficiently in advance.

40.22.3 Protection of Passenger Train Loading / Unloading Passengers

When adjacent track protection is required in order to unload/load passengers, do the following before notifying the passenger train that it is safe to proceed:

- If authority on adjacent track(s) has been established:
 - Contact train(s) or MW employee(s) with authority on adjacent tracks to ascertain current location and if the movement can be stopped short of the passenger train location.
 - If unable to stop short of the passenger train, do not provide protection to the passenger train, until protection can be established on the adjacent track(s).
 - If the movement is able to stop short of the passenger train location, instruct the crew and/or MW employee(s) to "Stop short of the passenger train located at MP XX.X".
 - Place track blocks on adjacent tracks.
- If authority has not been established on the adjacent track(s):
 - Place blocking on adjacent tracks to prevent movement into the area where the passenger train has requested adjacent track protection.
- Do not remove track blocks until the passenger train releases protection or departs the location.

40.23 On-duty—Dispatchers and Probationary Dispatchers

Unless an emergency exists, all train dispatchers, including probationary dispatchers and others training are not to leave their assigned workstation (for other than customary reasons such as restroom break, warming of lunch, etc.) without permission from the Chief Dispatcher for that territory.

Dispatchers who are training and probationary dispatchers are required to be present for both beginning of shift transfer and end of shift transfer.

Train dispatchers must:

- Have clear, concise and professional communications.
- Refrain from hints of rule circumvention.
- Refrain from derogatory remarks or comments.
- Conduct conversations with field employees regarding train movements and/or MW work activities by utilizing only company provided communication devices.
- Ensure non-work related activities do not interfere with performance of duties.
- Have personal cell phones and personal electronic devices turned off and not in use while in dispatcher work areas. (Such devices include, but are not limited to: Cellular phones, Smart Watches, laptops, tablets, electronic recording devices, e-readers, Bluetooth earbuds/ headphones, smart glasses, etc.).
- Not frequent unoccupied work areas or work areas not pertinent to duties.

40.24 Hi-Rail Limits Compliance System (HLCS)

The Hi-rail Limits Compliance System (HLCS) is a safety system designed to monitor the position of HLCS equipped on-track equipment.

Briefing Requirements

Where HLCS is in effect, a briefing between the employee receiving authority and the Train Dispatcher / Control Operator regarding all HLCS numbers associated with the authority must occur:

- Before initial authority is obtained each calendar day.
- Before first authority is obtained following Train Dispatcher / Control Operator shift change.
- Before an employee operates into a territory controlled by a different Train Dispatcher / Control Operator.
- When employee changes vehicles.

Electronic requests of authority via approved electronic devices (e.g., Smart Mobile Client) which include all required HLCS information satisfy HLCS briefing requirements.

Authority Association

The Train Dispatcher / Control Operator must associate identification numbers of HLCS equipped on-track equipment with applicable authority(ies) as provided by field employees receiving authority.

Note: HLCS cannot be associated with a Track Bulletin Form B or non-computerized Track and Time issued verbally by the Train Dispatcher/Control Operator (during code brown conditions, CTC outages, etc.).

HLCS Alerts

On territories where Hi-Rail Limits Compliance System (HLCS) is in effect, a warning display will appear on control system equipment when GPS and HLCS equipped vehicles associated with an authority indicate outside of their authority limits. When warning is displayed:

- Promptly check for conflicting authorities and provide protection against any conflicting movements.
- Do not request any signal or switch changes within or at either end of the authority limits associated with the alarming equipment until the status of that equipment has been determined.
- Contact the employee or vehicle number that was reported in the warning, advising them where the system indicates they are located and ask them to verify their location.

If it is determined that the employee or vehicle is located outside the limits of the authority:

- Instruct the employee to stop the movement.
- Protect the movement.
- Report the incident to the Chief Dispatcher and Signal Call Desk.

If it is determined that the employee or vehicle has not exceeded the limits of authority and reason is not determined to be a thumb wheel issue or other explainable reason, report this information to the Signal Call Desk at the earliest opportunity.

40.25 Emergency Brake Application—Report to Train Dispatcher

When a train is stopped by an emergency brake application, whether it is induced by the engineer or other employee controlling the move, or by an undesired emergency brake application, a crew member will communicate the following information to the train dispatcher:

- The mile post location where the emergency brake application occurred.
- Brief report of who/what caused emergency application and factors involved.

Report this emergency braking information to the appropriate parties by using one of the following methods, listed in order of preference of use:

- Enter as a CAD “OT” delay with a “UE” or “IE” inspection result code.
- Enter as a TSS Train Stop Event (TSE) “OT” delay with a “UE” or “IE” inspection result code.

40.25.1 Undesired Emergency Application (UDE)

When train is stopped by an undesired emergency application:

- Ascertain from crew if train has experienced a previous undesired emergency application.
- Ensure crew contacts mechanical desk for assistance.
- Inform Chief Dispatcher of UDE and if previous UDE has occurred.
- Review the train's UDE history to determine if third UDE process below is required. TSS commands SOCD (option 1) or DELAY are useful tools for this review.

When train has stopped because of third UDE and no defect(s) have been previously found or corrected:

- Entire train must be parked for mechanical inspection.
- Ensure crew contacts mechanical desk for assistance.
- Be governed by Chief Dispatcher's instructions concerning location to park train. (Location must allow for safe inspection by mechanical department employees).
- Contact SID and ROCC to report location of parked train.

Note: When probable cause of UDE is found and corrected the total UDE count is reset to zero.

40.26 Dimensional Shipments

In addition to instructions in Item 7 of System Special Instructions, when the dispatcher is notified that a train contains dimensional shipments, the dispatcher must:

- Check for proper routing and determine if any conflicts exist with trains, equipment or dimensional cars. If not otherwise provided, the dispatcher may access the dimensional shipment bulletin restrictions by running HIWIG on a TSS command line and entering the car number. If movement authorization bulletin restriction is not available, contact the BNSF clearance bureau during normal business hours. If unable to obtain approval, notify field forces and the appropriate Chief Dispatcher that shipment must be held for proper authorization.
- At locations where the dimensional shipment track bulletin restriction or message identifies a conflict, use restrictive tags or track blocks to restrict access to the conflict(s).

Dimensional Shipments Tied Down On Line

Train

When a train with dimensional shipment cars is tied down on line:

- Determine the location where the train will be tied down. Do not tie the train down at a location where the dimensional shipment's track bulletin restriction shows conflict exists with another train, equipment or another dimensional shipment already on the territory.
- Place restrictive tags on adjacent tracks noting the presence of a dimensional shipment. (Ex. Hi/Wide car on (name of track); maximum width XX feet X inches).

Cars

When dimensional shipment cars will be tied down on line as standing equipment (not in train) provide protection as follows:

- Determine the location where car(s) will be set out. Do not set the car(s) out at a location where the dimensional shipment's track bulletin restriction shows conflict exists with another train, equipment, or another dimensional shipment already on the territory.
- Issue a Form C track bulletin restriction stating the car initial, number, location set out and that it is a dimensional shipment, showing the maximum width of the car. (Example: Dimensional shipment BNSF 123456 on siding Henson; Maximum Width 11 feet 6 inches).
- In addition, use restrictive tags or track blocks to restrict access to the dimensional shipment.

40.27 Smart Mobile Client (SMC)

Request for Authority

All SMC Authority Requests

The following must be included in all SMC authorities:

- Associated HLCS number(s) or “none” if HLCS is not being utilized.
- Engine ID(s) for all applicable trains when authority is issued “behind”.

The following information, which is required in CTC when authority is issued within a control point or will include “switch-yes” at either end of the authority limits may be included with SMC authority requests:

- Hand operation of dual-control switches.
- Notification that work in the control point may cause a track indication (shunt).

When SMC is utilized to request authority within a control point or that will include “switch-yes” at either end of the authority limits, and information regarding track indications and/or hand operation of dual control switches is included in the request, the Train Dispatcher / Control Operator is not required to have an additional briefing regarding track indications and/or hand operation of dual control switches.

Initial Request for Authority

In addition to the above, an initial request for authority must include:

- Employee's title.
- Location where track will be initially fouled, occupied, or used for protection.
- If authority is to be issued “behind” train(s), employee must state if train(s) to be listed “behind” are physically passing or have passed the point of entry.

If required information is not included, deny the request with an explanation of information needed so that all required information can be sent with subsequent request.

Subsequent Authority Requests

Once an initial authority has been issued to a SMC user, the following applies:

- The employee is not required to state the point of entry for each contiguous authority.
- The employee is not required to restate their title on contiguous authority requests.
- If initial authority was issued behind train(s), it is not necessary for the employee to restate that these trains are by the point of entry on contiguous authorities.

Note: If an authority is issued behind a train, and a subsequent authority does not contain the “behind” train verbiage, the employee must state if train(s) to be listed “behind” are physically passing or have passed the point of entry before the next authority is issued.

If an employee releases all held authorities, and requests new authority via SMC, obtain all information required for an initial request described under “Initial Request for Authority”.

Modifications to Authority Requests

SMC requests may be modified by the Train Dispatcher / Control Operator as follows:

- “Until” time.
- HLCS vehicle number(s).
- Sole/joint status.
- Train(s) listed “behind”.

Messaging System

Information that may be acted upon using the SMC messaging system once a response is received from the Train Dispatcher / Control Operator:

- Permission to take dual control switch or derail in hand operation. This may be accommodated by use of either SMC Position of Switch function included in the authority request or SMC message after authority has been granted.
- When dual control switch is placed back in power.
- Requests to add/change HLCS number(s).
- Modification of "until" time.

Note: Train Dispatcher / Control Operator must reply to requests/information above before an employee can consider approved/received. Employee must include name and location of Main Track switch(es) or derail(s) when requesting hand operation or restoring to power.

If any of the following are received using SMC, deny the request and contact the employee to confirm the information:

- Form A, B, C or TCM restriction requests, voids or modifications.
- Automatic crossing warning device or crossbuck repairs. However, SMC XING Tag request may be used.
- Any reports of unusual conditions.
- Completion/results of required track inspections (Example: flash flood warning, track indication, high temperature, etc).

Train Dispatcher / Control Operator Initiated Authorities

The initial authority received by a MW employee for each tour of duty must be requested by the MW employee. The initial authority cannot be generated by the Train Dispatcher / Control Operator.

SMC authorities may be initiated by the Train Dispatcher / Control Operator under the following conditions

- A job briefing must be held in which the MW employee and Train Dispatcher / Control Operator must agree that the Train Dispatcher / Control Operator may initiate and send SMC authorities. This job briefing must occur for:
 - Each MW employee's tour of duty.
 - Each request to a different Train Dispatcher / Control Operator (by initials or territory).
- The MW employee has existing authority in effect and subsequent authority will overlap or be contiguous (end-to-end) to existing authority.

SMC authorities must not be initiated by the Train Dispatcher / Control Operator if MW employee is not currently holding authority.

SMC authorities must not be initiated by the Train Dispatcher / Control Operator until confirmation is received that train(s) listed "behind" are physically passing or have passed the location where the limits of authority will be entered:

- If existing authority does not include "behind" but subsequent overlapping or contiguous authority requires "behind".
- If the train(s) listed "behind" on existing authority change on subsequent overlapping or contiguous authority (Example: if authority 123-45, currently held by Foreman Smith, indicates "behind BNSF 6755 East" and subsequent contiguous authority 123-47 to Foreman Smith indicates "behind BNSF 6755 East and BNSF 6334 East" the authority must not be initiated by the Train Dispatcher / Control Operator until confirmation is received that BNSF 6755 East and BNSF 6334 East are physically passing or have passed the location where the limits of the authority will be entered). Note: this includes crossing over from one track to another in multiple main or double track territories or when leaving a siding to enter a Main Track.

40.28 Trains Performing Work Associated with Track Maintenance

In signaled territory, when notified by the conductor of a train performing work associated with track maintenance (i.e., dumping ballast, loading/unloading track materials, snow removal, etc.), the following will apply:

In CTC:

- Job Brief with the conductor to ensure a clear understanding of the mile post limits to be used by the train performing work associated with track maintenance.
- Place a restrictive informational tag(s) in the control system at the affected location and notify any following train within the same limits about the train performing work associated with track maintenance and the limits where they are working.
- Prior to authorizing a train to enter a track that allows direct access to the mile post limits identified by the conductor of the train performing work associated with track maintenance, inform crew of train being authorized about the train performing work associated with track maintenance and the limits where they are working.

In ABS:

- Job Brief with the conductor to ensure a clear understanding of the mile post limits to be used by the train to perform work associated with track maintenance.
- Place a restrictive informational tag(s) in the control system at the affected location and notify any following train(s) within the same or overlapping limits about the train performing work associated with track maintenance and the limits where they are working.

Maintain the restrictive informational tag and continue notifications until advised by the conductor that work associated with track maintenance is complete.

40.29 Absolute Block Protection

Provide absolute block protection, where required, by placing track blocks in the control system to prevent overlapping authorities with other trains from being established in the area where a train requiring absolute block protection has been authorized to operate.

When required, absolute block protection must be maintained until:

- The train has released authority.
- The train has traversed beyond the next controlled signal,
or
- Conditions have changed to where absolute block protection is no longer required.

40.29.1 Vacant Track Protection

Vacant track protection is a form of absolute block protection which establishes vacant track in advance of and behind a train with main/ controlled track authority. Establish vacant track protection as follows:


Track Warrant Territory (ABS or Non-Signaled)

Track blocks must be applied in the control system on track segments:


- Where the train is authorized to operate by track warrant, unless operating with sole bi-directional authority.
- 1 mile in advance of the train's authority limits or to the next siding switch beyond the last authorized switch location.

Examples:

- Train has authority to MP 5. Blocking is placed ahead of the train between MP 5 and MP 6.




- Westbound train has authority to the ESS at Anna. Blocking is placed from the end of the train's authority to the next switch, WSS Anna.

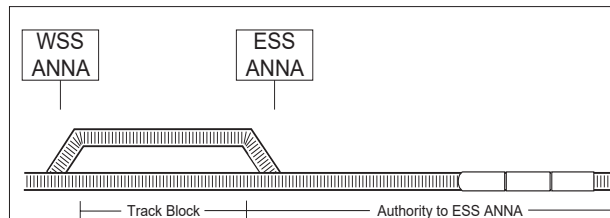


- 1 mile behind the train's authority limits or to the switch prior to the "from" location.

Examples:

- Train has authority starting at MP 5. Blocking is placed behind the train's authority limits between MP 4 and MP 5.



- Westbound train has authority beginning at the WSS at Bess. Blocking is placed between the "from" location to the previous switch behind the train's authority, ESS Bess.

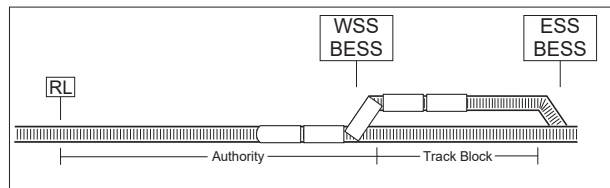

Adjust blocking as necessary when a train crew performs a partial release of authority.

CTC Territory

Track blocks must be applied in the control system on track segments:

- Where the train is authorized to operate. (e.g. Locations where a train is authorized by signal indication, verbal authority to enter controlled track, verbal authority to pass Stop indication, etc).
- In the control point(s) and track segments beyond the control point at either end of the train's authority.
- Where the train has track & time.

Note: If a train protected by vacant track protection has track and time which ends in a control point, apply track blocks to the track segments beyond the control point.

Instructions for All Territories

When providing vacant track protection, maintain track blocks until:


- The train has released authority.
- The train has cleared the controlled track.
- It is necessary to issue subsequent authority. (Blocking must be applied once additional authority is granted),
or
- The train status changes to where vacant track protection is no longer required.

When meeting trains, one of the following methods must be used to provide vacant track protection:


- The train carrying IH cars may only be issued authority to the first siding switch at the meeting location. The opposing train must be stopped in the siding track at the meeting location before a subsequent authority can be issued to the train carrying IH cars,
or
- A train carrying IH cars must be stopped at the meeting point before the one-mile vacant track protection may be removed and additional authority granted to accomplish the meet.

Examples:

- Train with IH cars holds the main track: Westbound train with IH cars requiring vacant track protection will meet an eastbound train at WSS Bess. Before a subsequent authority can be issued to the train with IH cars, the eastbound train must be stopped at ESS Bess.

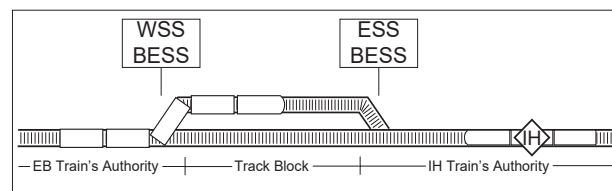

- Train with IH cars takes the siding track: Westbound train with IH cars requiring vacant track protection will meet an eastbound train at WSS Bess. The train with IH cars will take the siding to allow the eastbound train to pass. Before a subsequent authority can be issued to the eastbound train, the westbound train with IH cars must be stopped at WSS Bess.

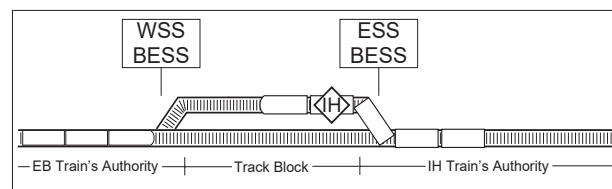

Joint / Overlapping Authorities

Do not issue authorities which would create joint or overlapping limits between a train protected by vacant track protection and another train or MW employee unless:

- An unusual circumstance exists,
or
- When interchanging cars and/or locomotives.

Note: When joint authorities are issued to trains, only one train may move at a time. To the extent possible, minimize limits where trains will receive joint authority under the exceptions above.

If unusual circumstances exist where it is necessary to issue joint or overlapping authority with a train protected by vacant track protection, do so only when the following conditions have been met:

- The train with vacant track protection is stopped and has been instructed to remain stopped.
- The train dispatcher has job briefed with the crew of the train protected by vacant track and with all other train(s) and/or MW employee who will be issued joint/behind authority.

Do not allow the train with cars containing any quantity of PIH/TIH materials to move until all other authorities have been released and vacant track protection has been reestablished.

40.29.2 Absolute Block Protection from Following Movements

When establishing absolute block protection from following movements, place track block(s) in the section(s) of track where the train requiring the absolute block is authorized to occupy the track.

Maintain blocking until:

- The train has released authority.
- The train has traversed beyond the next controlled signal,
or
- Conditions have changed to where absolute block protection for following movements is no longer required.

Do not utilize stored/stacked routes to authorize movement into a location where a train with an absolute block from following movements is operating.

Do not issue track warrant authority to another train behind a train requiring absolute block from following movements.

40.29.3 Absolute Block Protection in Advance of Train

When establishing absolute block protection in advance of a train, ensure the route ahead is clear of trains before authorizing a train into the limits unless:

- Train requiring advance absolute block protection is issued joint Track and Time.
- Train requiring advance absolute block protection is issued a joint Track Warrant including the limits where overlapping authorities exist.
- Protection is being provided per GCOR 11.1 Establishing Absolute Block.

[TOC Home](#)

41.0 General Track Bulletin, Track Warrant and Track Bulletin Restriction Instructions for Train Dispatchers

41.1 Ready for Delivery

Have general track bulletins ready for delivery to avoid train delays.

41.2 Addresses

41.2.1 Address Instructions

Address track warrants and general track bulletins as follows:

Trains:

Single Direction Authority

Designate trains authorized to proceed in one direction only by initials, engine number and direction.

Example: BNSF 528 West

Work Between Authority

Designate trains authorized to “work between” by initials and engine number.

Example: BNSF 3650

Initial Bulletin Restriction Delivery

Designate trains by train symbol, initials and engine number.

Example: Z WSPNBY9 10 BNSF 528

GTB Engine Unknown

When transmitting electronically and engine number is unknown, use “Eng Unk” in place of initial and engine number.

Example: Z WSPNBY9 10 Eng Unk

When creating a general track bulletin for delivery to train, ensure identifying engine matches the identifying engine in the CAD train sheet record. This does not apply to general track bulletins issued to yard engines or “Eng Unk”.

Note: Address MW equipment operated as a train (piloted by TY&E personnel) as shown above for trains except always show the initials as “MW” even if “MW” is not stenciled on the equipment.

Note: Passenger trains operated control cab forward are to be addressed by a locomotive number, not by the control cab car number.

Yard Engines:

Initial Bulletin Restriction Delivery

Designate engines confined to yard tracks and/or portions of Main Track(s) where authorized by GCOR 6.13 or 6.14 as “Yard Eng (Initials & No.)” when verbally transmitted. Add the job symbol and date, or “Y Yard” or “Y Eng” followed by shift number and date when transmitted electronically.

Examples:

Verbal: Yard Eng BNSF 3650

Electronically: Y SB101 26 Yard 0700 (Initials & No. Optional)

Y Yard1 26 Yard 0700 (Initials & No. Optional)

Y Eng2 26 Yard 1500 (Initials & No. Optional)

Yardmasters:

When general track bulletin delivery will be made via a yardmaster or ATM, address the general track bulletin as follows:

- Y Yard1 (date) at (location)
- Y (job symbol) (date) at (location)

or

- YM and Yard Engs (on-duty time)

The number after the word Yard in first example should reflect the shift for which the general track bulletin was issued (1, 2, or 3).

Verbally Delivered Track Bulletin:

Address verbally delivered track bulletin restrictions as follows:

By initials and engine number with direction optional.

Example: BNSF 4978

BNSF 4978 West

41.2.2 Changing Address of General Track Bulletins or Track Warrants

The train symbol, initial, engine number, direction, or date of a general track bulletin or track warrant that does not grant authority may be changed verbally.

Before verbally granting permission to change address:

- Verify that the document in question is the correct document for the train,
and
- Ascertain that all required track bulletin restrictions in effect on territory you control have been or will be issued to train.

Grant verbal permission in the following format:

() has permission to change general track bulletin (or track warrant) (number) to read ().

If track bulletin restrictions are not current and it is practical to do so, issue a new general track bulletin or track warrant electronically with all required information.

When granting permission to change engine identification, make appropriate changes in:

- GTBCHK using IDChg command.
- CAD by selecting "Make ID Unit".

Confirm engine identification changes updated to TMDS.

If train originates or is currently located on another train dispatcher's territory, advise the crew to contact the appropriate train dispatcher for address change, unless other instructions define a different process.

GTB address changes should be made by the train dispatcher whose district the train will initiate movement on (this may not be the train dispatcher that delivered the GTB), unless other instructions define a different process.

If the train symbol on a general track bulletin is verbally changed, notify other train dispatchers within the crew route as GTBCHK and DSTL lists of trains generated by future track bulletin restriction issuance will be affected.

41.3 Track Bulletin Restrictions in Effect

At their initial station, issue the train crew a general track bulletin or track warrant that lists:

- Track bulletin restrictions in effect,
- or
- “None” or “No” if no track bulletin restrictions are in effect.

Make sure all track bulletin restrictions which are in effect between point of origin and final destination for a train crew are included in the general track bulletin or track warrant received at the initial station.

Convey track bulletin restrictions placed in effect at a later time by one of the following:

- List track bulletin restriction(s) on a subsequent general track bulletin or track warrant and:
 - Notify crew member or employee receiving/retrieving/delivering general track bulletins (GTB) that subsequent GTB or track warrant is being sent, providing number of the new GTB or track warrant.
 - Receive confirmation that crew will not leave without the new GTB or track warrant.
- Verbally transmit track bulletin restriction(s),
- or
- Send track bulletin restriction(s) electronically to a printer, fax or IPAD (Verify receipt of track bulletin restrictions delivered electronically without a general track bulletin).

Refer to TDCOM 41.5.2 regarding restrictive track bulletin restrictions.

41.3.1 General Track Bulletin Not Received

When a general track bulletin is transmitted electronically in TSS and subsequently is not received by the crew or the destination fax machine or printer:

- Run TSS “General Track Bulletin Check” (direct command GTBCHK) to display the general track bulletin information in question.
- Use the “Resend” option to send an exact copy of the general track bulletin not received to the same or different location as necessary.
- Do not use the “Resend” function if current track bulletin restrictions are different than originally issued unless the change does not affect the train involved. Instead, issue a new general track bulletin, providing the train crew with the new general track bulletin number.

41.4 Track Bulletin Restrictions in Yards

Yardmaster and Yard Engines

At the beginning of each yard engine and yardmaster's shift, issue a general track bulletin or track warrant addressed to the yardmaster and yard engines that lists:

- Track bulletin restrictions in effect,
- or
- “None” or “No” if no track bulletin restrictions are in effect.

Note: At specific locations identified by the Chief Dispatcher, general track bulletins or track warrants will be issued directly to the yard engines but in all cases a reference to yard engines must be included in the address.

41.5 Delivered to Printer, Fax, or Email

Note: These rules do not pertain to electronic delivery of mandatory directives using PTC.

41.5.1 Track Warrant

Track warrants granting authority may only be issued to a printer, fax, or email through the TWC system.

Note: When using the TWC system to issue track warrants granting authority for delivery directly to a printer or fax not dedicated to authority track warrants or not under direct supervision, do so only when the employee who is to receive the track warrant is physically at the location of the printer or fax. Do not issue a track warrant to a printer or fax if:

- The track warrant restricts authority or movement,
or
- The train or MW foreman has previously received authority to leave that station.

Verbally issue a restricting track warrant directly to a crew member or MW foreman. Do not use the second paragraph of GCOR/MWOR 14.13.

Do not issue a copy of a track warrant containing authority if another crew is operating under the authority of the track warrant. (Example: A crew is operating with track warrant 584-64 issued to BNSF 5726 West. A relief crew for this train contacts the dispatcher at their on-duty location requesting paperwork for the train to be relieved. Do not issue a copy of track warrant 584-64 to the relief crew).

41.5.2 Track Bulletin Restriction

Track bulletin restrictions may be issued to a printer, fax, or email using the GRIT and/or TSS system.

Do not issue a track bulletin restriction via printer, fax, or email if it restricts the train's movement and the train has received authority to leave that station.

Exception

Issuing a track bulletin restriction via printer, fax, or email is permitted if:

- Before issuing, the train dispatcher informs a crew member that the track bulletin restriction will be issued to a printer, fax, or email.
- The crew member assures the train dispatcher that the train will not leave without the track bulletin restriction.

41.5.3 Delivered to Printer, Fax, or Email and Void

When necessary to void a track warrant, track bulletin restriction or GTB delivered to a printer, fax, or email, void it directly to the conductor, engineer, or an employee qualified on the GCOR or MWOR.

41.5.4 Reserved for Future Use

41.6 Reserved for Future Use

41.7 Track Warrant / Track Bulletin No Longer in Effect

Unless using computerized TWC or TSS, when a track warrant or track bulletin restriction is no longer in effect, write "VOID" across it. If a track warrant has only track bulletin restrictions listed, mark it VOID after the crew has received the track warrant.

If handwritten track warrant or track bulletin is made void by a subsequent track warrant or track bulletin, record the voiding track warrant or track bulletin number next to the word "VOID". (Void by track warrant No. ____).

41.8 Track Warrant and Track Bulletin Restriction Examples

Use the following examples in track bulletin restrictions and track warrants:

41.8.1 Timetable, Special Instructions, or General Order Modifications

Use the following examples to change the timetable, special instructions, or a general order:

- (Division) Timetable No. ____ takes effect at (time and date).
- (Division) General Order No. ____ is canceled.
- (Division) Timetable No. _____ subdivision (all subdivisions) item number ____ is canceled.

41.8.2 Suspend Block System Signals per GCOR 9.23

Use the examples below only if the Division General Manager authorizes a block system or section of a block system removed from service. Specify the exact locations between which the block system is suspended:

- Effective time and date, block system is suspended on _____ track between ____ and ____.
Be governed by GCOR 9.23. TWC is in effect. Maximum authorized speed ____ MPH,
or
- Passenger trains ____ MPH and freight trains ____ MPH.

Add the following if necessary:

- At _____ interlocking signals remain in service.
- Automatic crossing warning device false or partial activation at (MP). Stop and protect movement, unless devices are seen to be working or otherwise instructed. Proceed per Rule 6.32.2, Procedure 2.
- At _____ dual control (switch(es), crossover(s)) are locked in hand position and lined and locked for Main Track movement.
- At _____ switch lined for _____ track.
- At _____ spring switch spiked for _____ track.
- At _____ automatic switches (out of service) or (remain in service).
- Position of switch form must be maintained. When releasing all or part of the limits, job briefing must be held with the train dispatcher about the position of Main Track switches and those switches operated are locked within the limits being released, referencing completion of the position of switch form or stating no entries required.

41.8.3 Trackside Warning Detectors and Signals

Use the following examples when detectors or signals are not in service or out of order:

- Signal(s) _____ temporarily out of service and block extended signal _____ to signal _____.
- Signal _____ out of service and must be regarded as displaying its most restrictive indication.
- At MP _____ (name of detector) out of service.
- (Time) until (time) cab signals will be inoperative between _____ and _____.

Note: Train dispatchers may issue these instructions verbally. It is the train dispatcher's responsibility to provide notification of the condition.

41.8.4 Speed Restrictions

Use the following examples when Form A track bulletin restriction is not in use.

- Do not exceed ____ MPH (on _____ track) between MP ____ and MP ____.
- Do not exceed ____ MPH at _____.
- (Psgr) (Frt) trains do not exceed ____ MPH (on _____ track) between MP _____ and MP _____.

Add the following if necessary:

- (Time) until (time).
- Track flags not displayed.
- Between (station) and (station).

41.8.5 Switches

Spring Switches

Protect spring switches that have been damaged or spiked by track bulletin restriction, track warrant, or flagman.

Spiked/Clamped Switches

Notify affected trains when a switch is spiked/clamped by track bulletin restriction or track condition message, whichever is applicable.

41.8.6 Flags Placed Less than Required Distance

When notified that yellow and yellow-red flags are placed less than 2 miles from the restriction, show the actual location of the flags in the flags column of the track bulletin restriction.

Leave the flags column blank when flags are placed at the required 2 mile distance.

Insert "GCOR 15.2.1" in the flags columns when issuing a GCOR 15.2.1 Form B track bulletin restriction.

41.8.7 Whistle Warning Request

When a whistle warning is requested, use the following example:

Whistle freely between MP _____ and MP _____ from (time) until (time) for (_____).

Note: Confer with your Chief Dispatcher before granting whistle warning to evaluate if appropriate warning is provided.

41.8.8 Occupied Outfit Cars are Set Out

When occupied outfit cars have been set out, use the following example:

At _____ occupied outfit cars on (track) must not be coupled to or moved without approval of the employee in charge.

41.8.9 Track Removed from Service

Double Track

When one track of Double Track is removed from service due to an interruption or repairs to track, issue instructions by track bulletin restriction as follows:

Effective (time), (track) out of service between (location) and (location).

These instructions may be modified by adding:

Engines must be authorized per GCOR 6.3 and directed by (name or title of employee) to use out of service track.

Make all movements on out of service track at Restricted Speed.

Single Track

On single track territory, except where CTC is in effect, when Main Track is removed from service and siding or other track is used instead, issue instructions by track bulletin restriction as follows:

At (location) after (time) Main Track out of service between (siding, house track, etc.) switches. Switches will be left lined and locked for movement through (track),

or

At (location) after (time) Main Track out of service between (siding, house track, etc.) switches.

Engines must be authorized per GCOR 6.3 and directed by (name or title of employee) to use out of service track.

Make all movements on out of service track at Restricted Speed.

Switches will be left lined and locked for movement through (track).

Switch Tender

If arrangements are made for switches to be handled by a switch tender, modify the Double Track example by adding the following, and replace that part of the single track example referring to switches being left lined and locked for movement through the siding or other track with the following:

Switch tender in charge of switches.

Within ABS limits, the following may be added:

When complying with the provisions of GCOR 9.12.4, the 5 minute waiting provision of GCOR 9.17 is suspended at this location.

Past Due Track Inspection

When a train or equipment has been tied down on a Main Track or siding for an extended period of time preventing required track inspection, an engineering employee may remove the track from service. When this occurs issue a Form C track bulletin restriction per GCOR 15.4 (Protection When Tracks Removed From Service). This will allow the tied down train or equipment to depart the out of service track when directed by the employee in charge as indicated on the track bulletin restriction.

The train dispatcher may relay instructions from the employee in charge for the tied down train or equipment to operate on the out of service track. Once the tied down train or equipment has departed the out of service track, subsequent trains may not operate on this section of track until track inspection is complete and the track is placed back in service, or as directed by the employee in charge indicated on the Form C track bulletin restriction.

Use the following example when issuing Form C track bulletin restriction for this purpose: “(Track) out of service between (MP) and (MP) per GCOR 15.4. Movements must be authorized by MW (Title or Name). Movement authorization may be relayed by the train dispatcher”.

This page left blank intentionally

42.0 Track Warrant Control Instructions for Train Dispatchers

42.1 Issuing Track Warrants

When issuing track warrants verbally:

- Before issuance, ascertain the following from the employee copying the track warrant:
 - Occupation.
 - Name.
 - Location on the Main Track or where Main Track will be entered. Confirm the point of entry is within current authority or requested limits.
- Use "X box", "Mark box" or "Check box" to indicate which box of the track warrant is to be marked and filled in by recipient.
- Transmit each entire line marked.
- Require the employee copying the track warrant to repeat each entire line marked.

42.2 Track Warrant Restrictions and Freeform Instructions

Do not grant authority or issue instructions by means of a track warrant freeform instruction via box 14:

- That may conflict with another rule or instruction.
- When another numbered box can be used.

When a track warrant that contains freeform text is voided, reissue the freeform text on subsequent track warrants:

- If it is desired the information remains in effect,
or
- If the condition is still in effect and the train has not traversed the limits of the condition.

42.3 Trains Occupying Overlapping Limits with Trains

ABS Territory – Joint authority may be used for trains occupying overlapping limits with other trains with no restrictions.

Non-ABS Territory - Joint authority may be used for trains occupying overlapping limits with other trains with the following restrictions:

- Train(s) authorized by proceed authority through the limits of a train(s) authorized by proceed authority, joint, must receive a track warrant with a joint restriction, only after departing the last station prior to the overlapping limits, and proceed authority must begin at the same location where the overlapping limits begin (i.e. the train's previous authority must not extend into the overlapping limits).
- Train(s) authorized by proceed authority which will move through the limits of a train(s) authorized by work between authority must receive a track warrant with a joint restriction, only after departing the last station prior to the overlapping limits, and proceed authority must begin at the same location where the overlapping limits begin (i.e. the train's previous authority must not extend into the overlapping limits).
- Train(s) authorized by work between authority with limits that overlap other trains authorized by work between authority must each receive a joint restriction with limits the same as their work between limits and must not receive the track warrant unless past the last station prior to the beginning of the work between limits. (Example: If one train is working between MP 0 and MP 10 and a second is working between MP 5 and MP 15, the first train's joint limits must be MP 0 and MP 10 and the second train's joint limits must be MP 5 and MP 15).

42.4 Maintenance of Way in Yard Limits / Restricted Limits

Do not issue MW employees track warrant authority to occupy the Main Track within yard limits or restricted limits.

42.5 Movement on Another District

Do not issue, report clear or release a portion of a track warrant authority that affects movement on another train dispatcher's district.

42.6 Protection Against Conflicting Movements

When issuing authority, provide protection against conflicting movements.

42.6.1 Use of "After Arrival"

"After arrival" authorities may not be issued:

- Within non-signaled territory or against the current of traffic.
- Into non-signaled territory or against the current of traffic from a signaled territory, such as CTC or ABS.
- If the opposing train is authorized by a work between (bi-directional) authority.

42.6.2 Use of "Behind" and "Clear At"

Behind

"Behind" must not be used when authorizing a train as a "work between" to follow a train authorized in one direction without also using "joint" for the overlapping limits for all involved trains.

"Behind" and "joint" must not be used when authorizing a MW employee to follow a train authorized to "work between".

Clear At Last Named Point

Use "clear at last named point" only when there is a switch at the last named point that can be used to clear the Main Track.

Do not use "clear at" on a track warrant that also uses "work between".

42.7 Adjacent Restricted Track

When TY&E employees request that train movement be restricted on adjacent tracks controlled by a BNSF train dispatcher, the following applies:

- Train dispatcher must job brief with the requesting employee on tasks to be performed and determine if conditions allow the work to be performed on the side opposite where a train may approach on the adjacent track.
- If tasks can be performed on the side opposite, the tasks are to be performed in that manner.
- When advised by the employee that tasks cannot be performed on the side opposite where a train may approach on the adjacent track, issue Track Warrant for the limits identified. For the address, use the identification of the train the requesting employee is assigned to.
- If a train is authorized through the identified limits, do not issue Track Warrant contingent upon a condition. Issue only after any train movement authorized is physically passing or has passed the location where the Track Warrant will be used.

Placement of a track block only to protect a TY&E employee request to restrict train movement on an adjacent track is prohibited.

Note: This rule does not apply when a passenger train crew member requests protection to load/unload passengers. Refer to TDCOM 40.22.3 for instructions pertaining to protection of passenger trains loading/unloading passengers.

42.8 Voiding Track Warrants

42.8.1 Voiding Existing Track Warrants

When changing the limits of an existing track warrant:

- Issue a new track warrant with an "X" in box 1.
- Consider both track warrants in effect until the OK time is acknowledged for the second track warrant.
- Make sure that the new track warrant limits include the entire train or MW equipment.

42.8.2 Changing Established Track Warrant Limits

Track warrants that restrict the movement authority of a train may be issued after a job briefing has occurred between the train dispatcher and the train crew regarding the new limits to be issued and the train crew confirms that they can comply with the changed limits. All other verbal requirements for reporting clear/releasing track warrants remain in effect.

42.8.3 Clear of Main Track

If a train reports clear of the Main Track under circumstances not normally requiring the train to report their track warrant clear, and it is the desire of the train dispatcher for the train to remain in the clear, void the train's track warrant or have the crew report clear of their track warrant.

Promptly inform the Chief Dispatcher of any employees who fail to report clear of their track warrant authority.

42.9 Electronic Delivery of Track Warrant (non-PTC Territory)

Where PTC is not in effect, the following applies to electronic delivery of track warrants:

Where electronic delivery is available on non-PTC territory, the train dispatcher may issue track warrant authority electronically to trains by selecting the appropriate locomotive number in the control system. Track warrants which are in effect must be made void by including a "Box 1" on a subsequent track warrant or by verbal release with the train crew.

In the event a track warrant is issued which includes limits in both PTC and non-PTC territory on the same subdivision, abbreviated verbal confirmation (as described below) is required.

Once authority is issued, the train dispatcher must contact the train to verbally confirm the track warrant was received including the following information:

- Track warrant number,
and
- "Box 5" (after arrival) if included on a TWC-ABS track warrant.

The train crew will confirm receipt of a track warrant by stating the following:

- Track warrant number.
- Limits.
- Track(s).
- Total number of boxes marked.
- Specific box number(s) marked.

If the information correlates with the electronically transmitted track warrant, the Train Dispatcher will confirm information repeated is correct by stating, "That is correct".

If the train crew cannot confirm that the track warrant has been received onboard the train, issue the track warrant using the verbal transmission / repetition process prescribed by TDCOM 40.7 and GCOR 2.14.1.

Notes:

- For trains operating with the PTC system cut-out or inoperable, the verbal transmission repetition process prescribed by TDCOM 40.7 and GCOR 2.14.1 must be used.
- Verbal briefings are required for:
 - Reporting clear of a track warrant that authorizes movement.
 - Releasing a portion of track warrant authority.
 - Reporting a switch in POS territory restored to normal position.

42.10 Electronic Delivery of Track Warrant (PTC Territory)

Where PTC is in effect, the following applies to electronic delivery of track warrants:

Confirmation of delivery is required for track warrant authorities transmitted electronically and may be accomplished using the following methods:

- Electronically—where the control system indicates “Electronic Delivery Confirmed” to the correct locomotive number,
or
- Verbally—where the train crew confirms the transmitted authority has been received.

When the control system indicates “Electronic Delivery Status Unknown”, the train dispatcher must brief with the train crew to confirm track warrant authority has been received referencing the track warrant number and limits. If the train crew is unable to verbally confirm that the track warrant has been received, issue the authority using the verbal transmission / repetition process prescribed in TDCOM 42.1 Issuing Track Warrants.

If PTC status changes to a condition where electronic view of the track warrant is not available on the PTC display, be governed as follows:

- Determine if the train crew copied the track warrant prior to the PTC screen becoming unavailable. If they did, then the train crew may repeat the authority information and the train dispatcher will confirm if it was recorded correctly.
- If the train crew did not copy the track warrant prior to the PTC screen becoming unavailable, reissue the authority using the verbal transmission / repetition process prescribed by TDCOM 40.7 and GCOR 2.14.1.

Notes:

- For trains operating with the PTC system cut-out or inoperable, the verbal transmission repetition process prescribed by TDCOM 40.7 and GCOR 2.14.1 must be used.
- Verbal briefings are required for:
 - Reporting clear of a track warrant that authorizes movement.
 - Releasing a portion of track warrant authority.
 - Reporting a switch in POS territory restored to normal position.

42.11 Handwritten Track Warrants

Issue handwritten track warrants only when approved by the Chief Dispatcher. The decision to use handwritten track warrants to grant authority will be made between the NOC GDT, Chief Dispatcher and Manager of Dispatching Practices and Rules.

42.12 Reserved for Future Use

42.13 Reporting Clear of Track Warrant that Authorizes Movement

In non-signaled and DT-ABS territory, before a track warrant with movement authority is reported clear, a job briefing must occur with the field employee about the position of Main Track switches and those switches operated are locked within the limits being released.

When a MW employee or train reports clear of a track warrant with movement authority and switch position job briefing, where required, has occurred, respond with the following:

- Name of the MW employee, or ID of train reporting clear of the track warrant.
- Track warrant number being reported clear.
- Track warrant limits that were authorized.
- Time track warrant was reported clear.
- The question, "Is that correct"?

For example: "BNSF 9912 East reporting clear on track warrant 31-14 between MP 110 and West Siding Switch Hope at 1013. Is that correct, over"?

42.14 Releasing Portion of Track Warrant Authority

In non-signaled and DT-ABS territory, before releasing a portion of track warrant authority, a briefing must occur with the field employee about the position of Main Track switches and those switches operated are locked within the limits being released.

When releasing a portion of track warrant authority, as outlined in GCOR 14.10/MWOR 14.12, the conductor (frt train), crew member (psgr train) or MW employee must provide the following:

- Name or other identification.
- Locomotive initials, number and direction, if applicable.
- Authority number.
- Location(s) releasing portion of authority "to" or "between".

The time entered when releasing a portion of track warrant authority may be different than the time the information was received. Enter the track release time in the system as the exact time the train or on-track equipment no longer occupied the limits being released.

Enter the track release time into the system and respond with the following:

- Name of the MW employee or train releasing a portion of the track warrant.
- Track warrant number being partially released.
- Location being reported past or track warrant limits that were released.
- Time track warrant was partially released.
- The question, "Is that correct, over".

Box 2 example: "BNSF 9912 East with track warrant 889-2 releasing clear of MP 125 at 1427. Is that correct over,

or

Box 4 example: "BNSF 9912 releasing that part of track warrant 889-2 between MP 110 and West Siding Switch Hope at 1013. Is that correct over".

If a freight train, including trains less than 12 axles, the engineer must confirm the correctness of the partial release by stating,

"Engineer (name), (limits released) is correct, over".

Do not complete the release process until confirmation of the limits released is received.

42.15 Overlap Circuits

Train dispatcher may instruct a train to pass an overlap sign on a siding when the train is not authorized to proceed beyond the leaving siding switch, if necessary, to accomplish train meets or when unforeseen conditions arise.

Before issuing this instruction, the train dispatcher must notify the engineer(s) of any opposing train(s) authorized to move out of the next station of this intent and reach a clear understanding concerning movements that will be made.

When report is received, or train dispatcher becomes aware a train has passed an overlap circuit without permission:

- Advise the train involved to Stop and remain stopped until further instructions are received from the Chief Dispatcher.
- Immediately notify the Chief Dispatcher.

42.16 Equipment that May Not Shunt the Track (ABS)

In ABS limits, unless authorized to move in both directions (work between or yard limits), establish absolute block protection from following movements for:

- Train movements with less than 12 axles,
or
- MW equipment operated as a train with less than 12 axles.

42.17 Permission to Pass Stop Indication in ABS

When a train requests permission to pass a Stop indication in ABS under GCOR 9.12.4, do the following:

- Verify that the train has authority beyond the Stop indication.
- Attempt to verify that no opposing train has violated its authority.

The train dispatcher may then give the train permission to pass the signal in the following words:

“After stopping, (train) at (location) has permission to pass signal displaying Stop indication”.

Note: When the Stop indication governs movement over a movable bridge, do not grant permission until an employee who has received instruction on movable bridge operation and inspection has inspected the bridge, unless specific instructions state otherwise.

42.18 Back Over Moves in Double Track Territory

Make back over moves in Double Track territory under the provisions in the second paragraph of GCOR 6.3 only when not possible to authorize the move with a track warrant.

When a back over move is being made, instruct the train crew to make all movements at Restricted Speed.

42.19 Protect Open Switch

Provide protection for open Main Track switches in track warrant territory only by use of a computerized track warrant system and under the following provisions.

Issue Authority - ABS Territory

Track warrant proceed authority for trains may be issued with no restrictions.

Track warrant work between authority for trains must end at any open Main Track switch. Authority may be issued beyond the open switch after the train has stopped at the switch.

(Note: A train stopped short of the switch for topographical reasons, i.e., road crossings, grade considerations, etc., may be considered as stopped at the switch for application of this process).

Track warrant authority for MW employees may be issued with no restrictions.

Issue Authority–Non-signaled Territory

Track warrant authority for trains must end at any open Main Track switch. Authority may be issued beyond the open switch after the train has stopped at the switch.

(Note: A train stopped short of the switch for topographical reasons, i.e., road crossings, grade considerations, etc., may be considered as stopped at the switch for application of this process).

Track warrant authority for MW employees may be issued with no restrictions.

When issuing a track warrant to a train entering or leaving the Main Track at a POS switch issue the authority with Box 13 checked, unless the crew advises they will normal the switch.

Restored to Normal Position–ABS Territory

A Main Track switch must not be restored to normal position in the TWC system unless:

- The employee reporting the switch to be normal is physically at the switch.
- The train or engine of the crew member reporting the switch to be normal is occupying the switch,
or
- The train or engine of the crew member reporting the switch to be normal is beyond the switch and is the most recent movement over the switch.

Restored to Normal Position–Non-signaled Territory

A Main Track switch must not be restored to normal position in the TWC system unless:

- The reporting employee (other than train crew member) has traversed the switch in Main Track to Main Track movement with on-track equipment or has made a walking inspection of the switch points and is physically at the switch.
- The train crew member reporting the switch to be normal is physically at the switch.
- The train or engine of the crew member reporting the switch to be normal is occupying the switch,
or
- The train or engine of the crew member reporting the switch to be normal is beyond the switch and is the most recent movement over the switch.

In Any Territory

When using the TWC system, before issuing a track warrant with “in effect after arrival of” and “permission to leave switches in reverse position” X'd, the opposing train's authority must previously have been issued beyond the switch to be left open.

Note: If this procedure is not followed, the train that is later authorized beyond the switch to be left open will receive a 'be prepared to Stop' at a switch that has not yet been left in the reverse position.

42.20 CTC Locations

Track warrants may be issued which include CTC territory within the designated limits. Use valid TWC locations for the “From” and “To” locations. Where CTC is in effect, CTC rules will govern.

42.21 Specifying Limits

When specifying the limits of a track warrant, use the mile post location of “Locations Not Shown as Stations” as shown in the timetable. Do not use names of “Locations Not Shown as Stations”.

42.22 Maintenance of Way Equipment

42.22.1 Contingent / Behind Authorities

Do not issue track warrant authority contingent upon a condition. Issue only after any train movement authorized is physically passing or has passed the location where the track will be entered.

If the authority issued to MW forces contains overlapping authority with the train:

- Job briefing must occur confirming the train physically passing or having passed the location where the track will be entered.
- Use “behind” to instruct the employee that authority is granted behind the train movement(s). However, if train(s) listed in “behind” reports clear of track warrant limits prior to reaching the end point of its authority and the MW authority extends beyond the train’s clearing point, reissue the MW track warrant without a “behind” before the MW movement passes the train’s clearing location.

If track warrant authority cannot be granted account train(s) are still approaching, instruct employee when to call back.

42.22.2 Overlapping Limits with Train

ABS and Non-ABS Territory– “Joint” may be used for trains occupying overlapping limits with men or equipment with the following restrictions:

- Train(s) authorized by “proceed” which will move through the limits of men or equipment authorized by track warrant must receive a track warrant with a “joint” restriction, only after departing the last station prior to the overlapping limits, and “proceed” authority must begin at the same location where the overlapping limits begin (i.e. the train’s previous authority must not extend into the overlapping limits). Men or equipment must receive “joint” for the entire overlapping limits.
- Train(s) that will be authorized by “work between” working in the limits of men or equipment authorized by track warrant must receive a track warrant with a “joint” restriction with limits the same as its “work between” limits, only when past the last station prior to the beginning of its “work between” limits. (Example: If men or equipment are working between MP 12 and MP 13 and a train wants to work between MP 10 and MP 20, the train’s track warrant may only be issued if it is past the last station prior to MP 10 (or MP 20, depending on direction of approach) and its “work between” and “joint” limits must both read “between MP 10 and MP 20.”) Men or equipment must receive “joint” for the entire overlapping limits.

42.22.3 Maintenance of Way Equipment Operated as a Train

When MW work equipment is operated as a train (piloted by TY&E personnel):

- Select proceed (Train) or work between (Train) from the menu list.
- Enter “MW” in the “TO” box followed by equipment number.

Do not issue track warrant to TY&E personnel by selecting “MW” from menu option(s).

Likewise, do not issue track warrant to MW personnel by selecting “train” from menu option(s).

42.22.4 Form B Track Bulletin Restriction and Crossovers

Outside CTC or interlocking limits, when track bulletin restriction Form B limits contain a crossover from the other Main Track, the employee in charge of the Form B track bulletin restriction will ensure that the crossover switches are:

- Lined in normal position.
- Spiked, clamped or locked with an effective locking device.
- Properly tagged.

Prior to authorizing movement through one of these crossovers, the employee in charge of the Form B track bulletin restriction must be notified of the intent to use the crossover and arrangements made for this employee to facilitate removal of the tags and spikes, clamps or effective locking devices.

43.0 Track Bulletin Restriction and Track Condition Message Instructions for Train Dispatchers

43.1 Reserved for Future Use

43.2 When Track Bulletin Restriction is Requested

When notified of a track condition on a Main Track, siding or controlled track or asked to place a track bulletin restriction, issue a track bulletin restriction to cover the condition, unless otherwise instructed by the Chief Dispatcher.

Do not accept requests for or changes to existing restrictions (Form A, B, or C track bulletin restrictions, or TCM) via Smart Mobile Client. If such a request is made via Smart Mobile Client, deny the request and contact the employee to confirm the information.

Make sure that information issued on track bulletin restrictions:

- Corresponds with the request for the track bulletin restriction.
- Is in accordance with the rules.
- When received verbally from the field, is recorded on the prescribed form.

43.3 Condition Permanent

When issuing a track bulletin restriction for a permanent track condition:

- Verify with MW personnel that the condition is permanent.
- Show the track condition followed by **“This condition becomes permanent on (date)”**.
- Make sure the permanent track condition is carried on the track bulletin restriction until:
 - The condition has been covered by track bulletin restriction for 60 days.
 - The Chief Dispatcher approves its removal.

Timetable and rules changes cannot be made permanent by track bulletin restriction.

43.4 Overlapping Green Flags

When a series of speed restrictions are close in proximity such that the green flags could overlap the yellow flags, as outlined by GCOR and MWOR 5.4.5, advise those requesting the restriction of the overlapping areas. In this case, coordinate with the MW employee so that only one green flag will be placed at the end of the last restricted area in each direction.

43.5 Issue Track Bulletin Restriction Verbally

Before issuing a track bulletin restriction verbally, require the copying employee to state occupation, name and location.

When verbally issuing a track bulletin restriction, record the time repeated next to the location where it was copied.

When issuing a track bulletin restriction Form A or Form B verbally, record restrictions in mile post sequence or tenths of a mile from a mile post. Show the track bulletin restrictions in one direction only.

43.6 Delivery of Track Bulletins and Directives Electronically via PTC

Where PTC is in effect, track bulletin and directive delivery notification and confirmation occurs as follows:

Directives Issued for Inclusion in GTBs

Form A and Form B track bulletin restrictions are delivered to PTC active trains when they are entered in GRIT. Crew notification of these new restrictions is immediately sent to the PTC onboard system to make train crew members aware of the new restriction. Form C track bulletins and Track Condition Messages are not delivered to the PTC onboard system.

Train Dispatchers must confirm delivery of track bulletins and other directives to trains using one of the following methods:

- Dispatcher Task List (DSTL).
- “Route train” function in TMDS.
- Verbally with the train crew.

Temporary Restrictions and Crossing Warning Notifications

Temporary Track bulletins and other directives are delivered to PTC active trains when the Train Dispatcher places a restrictive tag for Form A speed restrictions and a restrictive or non-restrictive tag for Crossing Warning notifications in the train control system. The crew does not receive notification of a new temporary directive until the “route train” function is used when requesting the signal prior to the restrictive tag.

Train Dispatchers must confirm delivery of temporary restrictions to trains using one of the following methods:

- “Route train” function in TMDS.
- Verbally with the train crew.

43.6.1 Confirmation of Track Bulletins and Directives Delivered Using PTC

Train dispatchers are required to confirm delivery of track bulletins and other directives which are delivered using PTC. Electronic delivery confirmation of Track Bulletins and Crossing Warning Notifications can be accomplished using the following methods:

Delivery Confirmation Using DSTL

Temporary Track Bulletins can be confirmed using the Dispatcher Task List (DSTL) command in TSS.

Delivery Confirmation/Crew Notification Using the Route Train Function in TMDS

Where a restrictive tag exists, confirmation of directive delivery and crew notification can be accomplished using the TMDS Route Train function for Track Bulletins and Crossing Warning Notifications. Train dispatchers must select the train symbol first in TMDS for PTC active trains and use the Route Train function to provide notification to the crew and confirm that the Track Bulletin / Crossing Warning notification corresponding to the restrictive tag has been delivered. The train dispatcher must confirm that the engine number in the TMDS generated box corresponds to the selected train and verify that electronic delivery is confirmed. If confirmation status is unknown, the dispatcher must verbally confirm with the train crew unless verbal confirmation has already taken place. This verbal confirmation also serves as the train crew's notification of a new track bulletin or other directive.

Verbal Confirmation

In the event that the system does not confirm delivery to the on-board display, the dispatcher must verbally confirm with the train crew using the following method:

- Contact train crew member referencing the system generated number created by TMDS/ GRIT to ascertain if track bulletin/directive is on the PTC on-board system.
- If the track bulletin/directive is on the PTC on-board system, a train crew member must repeat the system generated number back to the train dispatcher.
- After receiving confirmation from the train crew, enter an OK time and DS initials on the paper or electronic form. Do not issue the OK Time or DS initials to the crew.

(Note: It is not necessary to obtain the occupation, name or location of the crew member providing confirmation of the restriction number).

If the crew member cannot confirm track bulletin/directive delivery to the on-board system, the train dispatcher must deliver the track bulletin or directive verbally as prescribed in TDCOM 43.5 and 51.5.

43.6.2 Loss of On-Board Information

When PTC status changes to a condition where the electronic view of track bulletins/directives is not available on the PTC display, the train crew may continue operating the train:

- If no track bulletins/directives have been delivered electronically while enroute.
- If track bulletins/directives have been delivered enroute and can be verbally delivered prior to the train reaching the restriction(s).

If crew is unsure if restrictions have been electronically delivered, or of the location of electronically delivered restrictions, the train must be stopped, consistent with good train handling.

When a train crew contacts the train dispatcher due to an electronic view of restrictions being unavailable, the train dispatcher will determine what track bulletins/directives need to be delivered to the train crew. If any enroute track bulletins/directives are required, the train dispatcher will verbally deliver the information and advise when the train may proceed. Necessary track bulletins/directives must be delivered before the train reaches the location of the track bulletin/directive.

43.7 Separating Information—Form C Track Bulletin Restriction and Track Condition Message

Use location or mile post fields in TSS to separate information in Form C track bulletin restrictions and track condition messages. (This correctly aligns the information and enables the GTB system to display information properly).

43.8 Delivering Track Bulletin Restrictions

Deliver track bulletin restrictions to all trains affected by the restrictions. If a train reports an unspecified yellow or yellow-red track flag and a restriction is in effect that corresponds with the location of the track flag, the restriction must be delivered to a crew member in writing prior to the train entering the mile post limits specified by the track bulletin restriction. A train dispatcher receiving a report of an unspecified track flag must report it to the Chief Dispatcher.

Note: This does not apply to dispatching positions exempted from using DSTL by Dispatcher's Notice.

In the GTB system, track bulletin restrictions are delivered based on train schedules. DSTL presents origin/destination stations based on schedule information. Do not depend solely on this origin/destination pair to ensure that all needed track bulletin restrictions will be delivered. Verify the subdivision templates display the expected limits that the train will be traversing.

43.9 Improperly Displayed or Missing Track Flags and Signs

43.9.1 Improperly Displayed or Missing Track Flags

When notified that track flags are improperly displayed or missing, notify the NOC MOW Help Desk. In addition, if the missing track flag(s) are for an active Form B restriction, immediately notify the employee in charge of the Form B or the employee's supervisor.

When train crews inquire about yellow or yellow-red track flags displayed in the field, only give information about track bulletin restrictions that are in effect at that location. Do not speculate about reasons for the presence of these track flags.

When no track bulletin restrictions are in effect at the location, the train dispatcher will inform the train crew there are no track bulletin restrictions restricting movement at that location.

43.9.2 Improperly Displayed or Missing Roadway Signs

When notified that Roadway Signs such as those described in System Special Instructions Appendix B, station signs, or mile post signs are improperly displayed or missing, immediately notify the NOC MOW Help Desk.

43.10 Form B Track Bulletin Restriction

43.10.1 Dual Control Switches within Form B Limits

Before the Form B start time, the employee in charge will conduct a verbal job safety briefing with the Train Dispatcher / Control Operator to address the following items:

- What tracks will be occupied or fouled.
- Which, if any, of the dual control switches in the limits will be occupied or fouled.
- What position dual control switches will be blocked.
- Routing requirements for movements within the limits.

Blocking Instructions

- The Train Dispatcher / control operator must block all dual control switches within the limits of the Form B in the requested position.
- Switch blocks must be identified in the control system by entering "Form B (number)".
- Once blocking has been placed, verbally confirm with the employee in charge that switch blocks have been applied to all switches in the requested position within the limits of the Form B.

If the employee in charge identifies routing restrictions other than, or in addition to, the dual control switch position, apply track blocks to the restricted area.

Switch blocks may be removed only under one of the following conditions:

- Form B is made void.
- Form B has expired.

Changes to the Switch Position

- When a change to the position of a blocked dual control switch is necessary, the Train Dispatcher / Control Operator must verbally brief with the employee in charge of the Form B before changing the switch position.
- If it becomes necessary for a train crew or a MW employee not working under the direction of the employee in charge to hand operate a blocked dual control switch within Form B limits, verbally brief with the employee in charge of the Form B before granting permission to take the dual control switches on hand.

Notes: A Remote Control Power Switch (RCPS) is a dual control switch.

Dual control derails within Form B track bulletin restriction limits are not affected by the application of this rule.

43.10.2 Cutoff Time for Issuance of Form B Track Bulletin Restriction

Do not issue Form B track bulletin restriction less than 12 hours prior to the effective time unless approved by the Chief Dispatcher. Do not change the Form B start or end times without approval from the Chief Dispatcher and verbal permission from the Employee in Charge.

43.10.3 Reserved for Future Use

43.10.4 No Overlapping Form B Track Bulletin Restriction Authorities

Do not issue Form B track bulletin restrictions with limits that overlap other Form B track bulletin restriction limits.

43.11 Permanent Speed Signs in Place

When a speed restriction has been issued on a general order, the track bulletin restriction covering that speed restriction must not be made void until MW forces report that permanent speed signs are in place for the restriction.

43.12 Easily Identifiable Locations

Designate locations in track bulletin restrictions by specifying track, where required, and exact points, such as switches, mile posts, or identifiable points.

Mile post locations will be shown in tenths of a mile post in Form A or Form B track bulletin restrictions. It may be necessary to show mile post locations in hundredths of a mile post in Form C, TCM or Crossing Warning Notification when referencing locations such as bridges or highway crossing at grade.

When issuing a TCM for temporary speed restrictions or other conditions on other than Main Track use identifiable points, such as switches, track names or commonly known locations, to define the limits of the restriction. Do not use mile post locations for conditions on other than Main Track, except for crossing warning notifications.

43.13 Written Instructions

Verbal issuance of track bulletin restrictions to trains must be copied in writing.

Only give verbal instructions in lieu of written instructions when the affected trains are in the immediate vicinity of the restriction when the condition is initially reported.

43.14 Rules Not in Effect

Do not use GCOR 15.3 (Authorizing Movement Against the Current of Traffic) on the BNSF Railway.

43.15 Void and Reissue

If an error is discovered in a track bulletin restriction after the OK time has been given, void the track bulletin restriction as prescribed by GCOR 15.13.1 and reissue with a different number.

43.16 Track Condition Messages

Issue track condition messages (TCM) to cover:

- Any restriction not normally covered by a track bulletin restriction.
- Restrictions that affect train movements on tracks governed by GCOR/MWOR 6.28.
- “Watch your footing” conditions, whether on Main Track or other than Main Track. (Note: Bridge walkways removed or out of service should be issued on Form C track bulletin restriction whether on Main Track or other than Main Track).

When entering “watch your footing” conditions:

- Indicate the cause (Example: rail alongside track, ties scattered, icy conditions, etc.).
- Use the phrase “watch your footing”. Do not use “bad footing”, “dangerous footing”, etc.

List Track Condition Messages in station sequence.

Monitor and update track condition messages, keeping all information current. Consult the Chief Dispatcher if in doubt as to whether information should be covered by track bulletin restriction or track condition message.

Issue notification of contractor's equipment working near Main Tracks with a track bulletin restriction. If contractor's equipment is on or foul of the Main Track or siding, protect the equipment per MWOR 6.3.1.

43.17 Use of Form A, B and C Track Bulletin Restrictions

Form A track bulletin restrictions contain speed restrictions on Main Track, siding or other controlled tracks only. The comment line should be used for exceptions or information associated with the current record speed restriction. The flag exceptions line should be used for flags that are located on a subdivision different from the subdivision where the restriction is located.

Form B track bulletin restrictions contain information about employees or equipment working on Main Tracks, controlled siding and other controlled tracks. The comment line should be used for information pertaining to the employees or equipment shown in the associated restriction. The flag exceptions line should be used for flags that are located on a subdivision different from the subdivision where the employees or equipment is located.

Form C track bulletin restrictions are freeform restrictions that may include the following items:

- Main Track out of service.
- Items affecting train movement on Main Tracks or sidings other than restrictions shown in track bulletin restriction Forms A or B. Note: With GST, GM, GDT or NOC GDT approval, Form A or Form B track bulletin restriction information may be issued on Form C track bulletin restriction. Examples of Form A or Form B track bulletin restriction information which may be issued on Form C are:
 - Speed restrictions that apply to specific train or equipment type.
 - When necessary to issue a Foreign Carrier's Form A or Form B track bulletin restriction information with general track bulletins.
- Bridge walkway out of service.

The following should be issued on General Order:

- Changes to signal or new signal installations.
- Timetable changes.

Use of a Form C track bulletin restriction to communicate changes normally issued on General Order requires GST, GM, GDT or NOC GDT approval.

43.18 Delivery of Track Bulletins and Directives Electronically (non-PTC Territory)

Where PTC is not in effect, electronic track bulletin and directive delivery notification and confirmation occurs as follows:

Temporary Form A (those assigned an automatically generated restriction number by GRIT) are delivered to PTC active trains when they are entered into GRIT. Form C track bulletins and Track Condition Messages are not delivered to the train's on-board system.

Temporary track bulletins and other directives are delivered to PTC active trains when the Train Dispatcher / Control Operator places a restrictive tag for Form A speed restrictions and a restrictive or non-restrictive tag for Crossing Warning notifications in the train control system.

43.18.1 Confirmation of Track Bulletins and Directives Electronically Delivered (non-PTC Territory)

Train Dispatchers / Control Operators must verbally confirm delivery of temporary track bulletins and other directives to trains utilizing an abbreviated repeat process.

If the train crew cannot confirm that the directive is displayed on the onboard display, issue the directive using the verbal transmission / repetition process prescribed by TDCOM 40.7 and GCOR 2.14.1.

In the event that a track bulletin or directive is issued which includes limits in both PTC and non-PTC territory on the same subdivision, then abbreviated verbal confirmation as described below is required.

Form A Track Bulletins

- The Train Dispatcher / Control Operator will state the Form A restriction number.
- The train crew will confirm receipt of the restriction by repeating:
 - Restriction number.
 - Milepost(s).
 - Speed.
 - Track(s) on which the restriction applies.
- If correct, the Train Dispatcher / Control Operator will confirm information repeated is correct by stating, "That is correct".
- After receiving confirmation from the train crew, enter an OK time and DS initials on the paper or electronic form. Do not issue the OK Time or DS initials to the crew.

Crossing Warning Notifications

- The Train Dispatcher / Control Operator will state the Crossing MP.
- The train crew will confirm receipt of the crossing warning by repeating:
 - Milepost(s).
 - Crossing procedure required.
- If correct, the Train Dispatcher / Control Operator will confirm information repeated is correct by stating, "That is correct".
- After receiving confirmation from the train crew, enter an OK time and DS initials on the paper or electronic form. Do not issue the OK Time or DS initials to the crew.

This page left blank intentionally

[TOC Home](#)

44.0 Instructions for Control Operators

44.1 OS Indications on CTC Machine

“OS” indications on a CTC machine that follow Proceed signal indications at control points can be used as follows:

- To determine the location of train movements in CTC.
- As proof that a train has left CTC.

This information cannot be used to issue track warrants.

44.2 Track Blocks or Restrictive Tags

Following are some instances when track blocks or restrictive tags must be applied to the control machine to prevent movement into the affected limits.

Provide restrictive tag(s) or track block(s) to:

- Prohibit movements on routes where a signal or signal appliance is functioning improperly or if damage occurs to the track. (GCOR 9.5.2).
- Prevent movement into track and time limits (track block(s) only). (GCOR 10.3.1).
- Provide absolute block protection for equipment that may not shunt the track (track block(s) only). (TDCOM 42.16, 44.5).
- Provide protection against conflicting movements for reverse movements (GCOR 6.4.1, TDCOM 40.9 and 44.12) or back up movements (GCOR 6.6, TDCOM 40.8).
- Provide protection for equipment left on track. (GCOR 6.20(B) and 15.5, TDCOM 40.11).
- Restrict access on adjacent track(s) in CTC territory when train stopped in emergency (GCOR 6.23) or stopped by dragging equipment or shifted load detector (GCOR 6.21.4).

Note: Signals that have been changed to display Stop indications must not be “in time” when advising crew that protection is provided.

- Prohibit movement into segments of CTC where fixed signals fail or are missing. (TDCOM 40.4.6).
- Prevent movement into a block when a signal is reported as failing to display its most restrictive indication when the block is occupied or a switch protected by the signal is changed from its normal position. (GCOR 9.7, TDCOM 40.4.7).
- Prevent movement onto track removed from service (track block(s) only). (GCOR 15.4, TDCOM 44.3).
- Prevent movement into blocks governed by signals reported as pumping or working erratically (GCOR 9.6). Note: Instruct trains to move at Restricted Speed in the block governed by the affected signal if moving on signal indication.
- Restrict access to track segments where restrictions and associated track flags have been placed that must be issued to trains that have already received a general track bulletin and are not required to secure an additional general track bulletin before reaching the location of the restriction (restrictive tag(s) only). (TDCOM 43.8, 49.1).

Note: Restrictive “SPEED” tag(s) placed to protect temporary speed restrictions not entered in GRIT must remain in the “restrictive” state until voided or issued in GRIT and delivered to all trains.

- Restrict access to affected limits of track bulletin restrictions when auto-populated to dispatcher task list (DSTL). (TDCOM 43.8).
- Restrict access to track segments affected by weather warnings. (TDCOM 53.2).
- Graphically indicate the location where a train(s) has been authorized when field forces remotely Clear signals under dispatcher direction during signal disruption (track block(s) only). Note: Track blocks must indicate train(s) identification by engine number and direction. Retain track blocks until train(s) no longer occupies the authorized limits.
- Restrict access to track segments where trains or engines could pass on a Main Track or controlled siding between a passenger train and station platform while passengers are being received or discharged (track block(s) only) (GCOR 6.30).
- Establish vacant track protection (track blocks only) (TDCOM 40.29.1).

Indicate on the transfer the purpose of any track blocks or restrictive tags still remaining at change of shift.

[TOC Home](#)

44.3 Track Out of Service

When track is out of service, apply track blocks on the control machine to prevent movement into the out of service track.

Do not establish a signal route to allow train movement into a track that has been removed from service.

44.4 Admit Train to Occupied Siding

Before allowing opposing trains to enter the same siding, notify the engineer of each train in advance.

44.5 Equipment that May Not Shunt the Track (CTC or Manual Interlocking)

In CTC or manual interlocking limits, unless track and time has been issued, establish absolute block protection from following movements for:

- Train movements with less than 12 axles,
or
- MW equipment operated as a train with less than 12 axles.

Note: If MW equipment operated as a train does not change controlled signals on the affected track to display to Stop indication when the control point is traversed by the equipment, discontinue operating the MW equipment on signal indication and authorize with movement under track and time.

Do not utilize stored routes for opposing moves at control points in advance of these type movements if signals are not cleared through the control point for the movement.

44.6 Lining Controlled Signals / Switches

Display controlled signals at their most restrictive indication; however, request Proceed signals well before movement to avoid giving an unnecessary restrictive indication.

Return dual control switches to their normal position in a timely manner after completion of movement over the switch. Do not line one end of an ICS crossover in reverse position when a train movement is authorized on the adjacent track over the other end of the same crossover in normal position, unless requested by MW or signal employee performing maintenance or testing on the switch under track and time authority.

44.7 Hold a Controlled Signal at Stop

Hold an absolute signal at Stop and verbally authorize movement beyond the signal at the request of a railroad supervisor.

44.8 Authority to Pass a Stop Signal

44.8.1 Authority to Pass Stop Indication

Before granting a train authority to pass a signal displaying a Stop indication, as outlined in GCOR 9.12.1 and 9.12.2:

- If Stop indication governs movement through an interlocking or onto an adjoining territory, job brief with the adjoining train dispatcher, control operator, or foreign line operator by phone or CAD IM to:
 - Establish a common understanding of the movement.
 - Request protection on adjoining territory (if necessary).
- Verify from the train crew that the Stop indication is visible.
- Block switches and derails to prevent movement requests. Blocking must be maintained until movement has completely fouled the control point.
- Apply track block or restrictive tag on the track segment beyond the affected control point and maintain until all trains authorized under provisions of GCOR 9.12.1 or 9.12.2 have occupied the track segment beyond the affected control point and have:
 - Received a Proceed signal at the next control point.
 - Occupied the next control point,
 - or
 - Reached the end of CTC or Manual Interlocking limits.

Exception: Track block or restrictive tag not required when the track segment beyond the affected control point is occupied by equipment to be handled.

Authorize trains to pass Stop indications one signal at a time.

44.8.2 Relaying Authority to Pass a Stop Signal

When direct radio communication is possible, do not allow another employee to relay the authority to pass a signal displaying a Stop indication. When another employee must relay this information, the employee must be qualified on the General Code of Operating Rules.

44.8.3 Bridges Protected by Absolute Signals

When unable to provide a Proceed indication at a signal governing movement over a movable bridge, and unable to determine from the control system that the bridge is secured in position for train movement, do not grant authority to proceed until an employee who has received instruction on movable bridge operation and inspection has inspected the bridge, unless specific instructions state otherwise.

44.9 Control System Equipment

44.9.1 Switch Correspondence

Use switch correspondence indication to verify that the switch is lined and locked for the route that will be used. A solid switch indicates the switch is mechanically locked and properly lined. A flashing switch indicates the switch is out of correspondence. If any of the following is observed, the switch at that location cannot be considered lined and locked unless a signal maintainer or MW employee at the location advises the switch is lined and locked or spiked and clamped for a specific route:

- The switch does not respond properly to requests.
- The control display indicates the field location is in FAILURE, MAINTENANCE, or LOCAL CONTROL mode on machines so equipped.
- The control system indicates the field location status is unknown (the condition referred to as "Code Brown").
- The "locked" indication is not displayed after the signal has been requested on machines so equipped.
- The track display does not indicate a known occupancy,
or
- The code system is not functioning properly.

Note: Do not tell crew members or MW personnel that the control machine indicates that the switch is lined and locked for the route that will be used.

44.9.2 Track Indications

The following applies when a track indication (intermittent or continuous) appears on the control operator's control system display in CTC territory or in manual interlockings. Take prompt action to protect affected train movements first, followed by other notifications.

Train Inspection

Track indications appearing behind a train movement are a warning of possible defective equipment on the train.

Instruct the train crew to Stop and inspect their train due to track indication(s) behind their train and refer the train crew to System Special Instructions Item 39 for:

- Key trains—When a track indication appears behind the Key train.
- Non-Key trains—When more than one track indication appears behind the non-Key train.

Regardless of train type:

- Contact the Mechanical Desk and secure any data on anomalous wheel readings for the train that is stopping to inspect.
- Relay any such wheel readings or related information to the train crew prior to the train inspection if practical to do so.

If defect is found, advise Chief Dispatcher and be governed by Chief Dispatcher instructions.

Call Desk Notification

- Promptly notify the Signal Call Desk with the location of the indication.
- Promptly notify the NOC MOW Help Desk (CAD IM or call the pre-programmed number on the communication console) with the location of the indication.

Operating Instructions

- Advise the Chief Dispatcher at first opportunity.
 - Do not authorize trains or light engine consists into an unidentified track indication between control points unless approved by Chief Dispatcher and it has been ascertained that the indication is not a conflicting train. Chief Dispatcher approval is not required if the track indication is within control point limits or track has been inspected and determined safe by signal or MW personnel.
 - If the indicating track segment was recently traversed by a train, contact the last train to traverse the affected track segment to verify the train's location to ensure the train symbol did not detach from the train. (Example: The train symbol left the track segment on the wrong train or "jumped" to the train ahead).
 - Do not issue track and time where an unidentified track indication exists without first ascertaining that no trains occupy the affected track. Make a general broadcast via radio to ensure there are no trains located in the vicinity of the track indication.
- Prior to traversing onto an adjoining BNSF train dispatcher territory, when a non-Key train leaves a track indication on your territory notify the adjoining train dispatcher by recorded phone or CAD IM.
- If approved by the Chief Dispatcher, advise train crew of the track indication and continue train movement, utilizing signal system unless track indication is intermittent or signal will not Clear. If track indication is intermittent or signal will not Clear, advise train crew of the track indication, then authorize train movement(s) to pass signal(s) displaying Stop indication as outlined in TDCOM 40.4.4 and 44.8.1. (Note: this applies to any type of "tie" territory—concrete, wood, steel, etc.).
- Discontinue train movement when signal maintainer and/or MW personnel arrive to inspect the condition and immediately give time to inspect the condition, unless otherwise advised by on-site personnel.

44.9.3 Local Control / Manual Operation

Signal Department Request to Place Control Point in Local Control / Manual Operation

Providing Protection:

When a signal department employee requests permission to place a CTC control point in local control / manual operation:

- Verify there are no pending or established signals at the control point.
- Apply track block(s) in the control point to prevent lining an unintended route. Note: If the location contains an Independently Controlled Switch (ICS), track blocks only need to be placed on the affected track(s).
- If unable to apply track blocks in the control point due to conditions such as code brown, apply track blocks on track segments adjacent to the requested control point to prevent access to the affected area.

If the employee requests permission to place the control point in local control or manual operation with the intent to line signals:

- Verify there are no pending or established signals at the control point or at adjacent control points into the track segment(s) where a locally requested signal could be established.
- Apply track block(s) in the control point and on adjacent track segments for affected routes. Exception: In locations where field blocking exists, apply signal blocks to signals governing movement to the affected route(s).

Confirm permission is granted to place the control point in local control / manual operation by verbally briefing with the requesting signal employee.

Maintaining Protection:

Once blocking has been established, do not attempt to operate switches or line signals in the control point unless specifically requested by the employee who was granted permission to place the control point in local control / manual operation.

Maintain protection until a job safety briefing occurs with the requesting employee to confirm that the control point is no longer in local control / manual operation.

44.9.4 Erratic Signal / Track Line Display

(Note: Erratic signal behavior may be referred to as “pumping” or “telegraphing”).

Absolute Signal

When a train crew member reports erratic signal or track line display behavior at an absolute signal,

or

When the control operator observes erratic or fluctuating activity at an absolute signal on the train control system:

- Ascertain from the engineer if the train can comply with a Stop indication at the location of the fluctuating signal.
- Place the signal to Stop.
- When train reports they can see the signal, use the Pass Stop Indication (PSI) function and authorize the train to pass the Stop indication.
- Report the condition to the Signal Call Desk.

Intermediate Signal

When a train crew member reports erratic signal or track line display behavior at an intermediate signal:

- Instruct the train crew to reduce to a speed not to exceed 20 MPH to the next signal.
- Report the condition to the Signal Call Desk.

44.10 Dual Control Switches / Derails

44.10.1 “Out of Correspondence” Switches

When dual control switch or switches in a control point do not indicate to be lined and locked, movement must be authorized past the Stop indication with instructions to operate dual control switch(es) by hand. Before doing so:

Control Points Not Equipped with Independently Controlled Switches (ICS)

- Apply blocking to all switches at the location to ensure switch control requests are not initiated.
- Apply track block(s) on any track segment that can be accessed through the out of correspondence switch.
- If opposing signals at adjacent control points in either direction indicate Proceed on any track that can be accessed through the out of correspondence switch, arrange to place those signals in Stop position and apply blocking, or, advise the opposing train of movement to be made and wait until opposing train has taken the opposing signal before authorizing movement and instructing hand operation of the out of correspondence switch.

Control Points Equipped with Independently Controlled Switches (ICS)

- Apply blocking to all switches at the location to ensure switch control requests are not initiated.
- Apply track block on the track segment beyond the affected control point where the train will be verbally authorized.

Instructions for All Control Points

- When authorizing movement past a Stop indication and instructing employee to operate dual control switch(es) by hand, do so with a single statement. (See Verbal Authority Examples below).
 - If applicable, specify the route to be traversed.
- When multiple switch machines are involved, instructions must include each switch machine to be traversed over the intended route.
- For turnouts equipped with two switch machines, include instructions to operate the moveable point frog(s).

Note: This rule does not apply to power operated switches not equipped for hand operation. These switches are not dual control switches. Instructions for granting authority to proceed over out of correspondence power operated switches not equipped for hand operation will be included in individual subdivision special instructions in the timetable of the affected territory if the practice is allowed.

Verbal Authority Examples

"After stopping, (train) at (location) has authority to pass signal displaying Stop indication and is instructed to operate switch(es) by hand for your route," specifying route where applicable.

Multiple Switch Machines

"After stopping, (train) at (location) has authority to pass signal displaying Stop indication and is instructed to operate switch(es) by hand for your route," specifying route where applicable.

Moveable Point Frog Location

"After stopping, (train) at (location) has authority to pass signal displaying Stop indication and is instructed to operate switch(es) and movable point frog by hand for your route," specifying route where applicable.

Code Brown

When the control system indicates the field location status is unknown (a condition known as "code brown") include instructions to hand operate all dual control switches for the route for each movement when movements are being authorized verbally.

44.10.2 Hand Operation of Dual Control Switches

A train or engine's authorized limits will extend to adjacent control points in **ALL** directions on all connected tracks when granted permission to operate a dual control switch by hand at a control point or manual interlocking unless specifically instructed otherwise.

Do the following before granting permission to operate a dual control switch by hand:

- Apply blocking to all dual control switches that are accessible by the train or engine in the limits described above.
- Apply a track block to the affected tracks. Note: If a track block is not available, set the signals governing entrance to the limits to display a Stop indication and apply available blocking devices.

Grant permission as follows: "**(Train) at (location) has permission to operate (specific dual control switch(es)) by hand.**" Added optional instructions, "**for switching moves only**", "**to double train together**", etc.

Note: Do not grant a train crew permission to operate a dual control switch by hand that allows access to a track where track and time is in effect without first giving the train track and time on the affected track unless the train dispatcher's instructions restrict the train's movement to exclude track segment(s) where track and time is in effect.

Establish conflicting routes and authorize conflicting movements only as follows:

- Job brief with affected trains regarding train movements.
- Issue track and time to affected trains prior to granting permission to hand operate dual control switch(es).

Engineering Employees

Before granting permission to engineering employees to operate a dual control switch(es) by hand, determine if doing so will affect signals on adjacent tracks.

If adjacent tracks will be affected, place track blocks to prevent lining signals into affected track segments before granting permission.

Note: Do not grant permission to take dual control switch(es) in hand operation when a signal request is pending or established in the affected control point.

44.10.3 Dual Control Switch / Derail Out of Service or Removed

When notified that a dual control switch or derail has been taken out of service or removed:

- Place a switch block on the switch/derail. Identify the switch block to indicate the switch/derail is out of service and when taken out of service. Example: "Switch/Derail out of service (date/time)".
- Maintain switch block(s) until switch/derail is placed back in service or has been removed from the control screen.

Note: Switch block may be removed to operate switch/derail under the direction of an engineering employee.

- Include out of service information on transfer(s) until repaired, removed from control screen or placed on Form C track bulletin restriction.

44.10.4 Dual Control Derails

Keep dual control derails in the derailing position, except when they are placed in non-derailing position to permit movement.

At movable bridges, dual control derails may be left in the non-derailing position while the bridge is secured in position for train movement.

44.11 Instructions in Release Box

In CTC territory, when a train is stopped at a signal displaying a Stop indication at an automatic interlocking with supervisory control and a crew member communicates with the train dispatcher or control operator, if no conditions exist to prevent doing so, instruct train crews to comply with instructions in the release box and authorize them to pass the signal as follows: **"After stopping and complying with instructions in release box, (train) at (location) has authority to pass signal displaying Stop indication"**, specifying the route where applicable.

GCOR 10.3 states "Track and time does not authorize trains to occupy the track within automatic interlocking limits".

MWOR 10.3 states "Track and time does not authorize maintenance of way employees and on-track equipment to occupy the Main Track within automatic interlocking limits".

When employees request protection within automatic interlocking limits with supervisory control in CTC territory, state the following:

"Be governed by instructions in the MW release box".

44.12 Permission for Reverse Movements

Permission for a reverse movement within CTC or manual interlocking limits may be granted to a train only if one of the following conditions is satisfied:

- The next controlled signal to the rear for a following movement is set to display a Stop indication, the track is clear of trains to the controlled signal and a track block or restrictive tag is placed in the track segment where the movement will occur.
- A following train, which has passed the last controlled signal to the rear, has been stopped and instructed to remain stopped until the reverse movement is completed and a track block or restrictive tag is placed in the track segment where the movement will occur.

44.13 Before CTC Is Suspended

Before suspending CTC, as outlined in TDCOM 41.8.2 [Suspend Block System Signals per GCOR 9.23 (Suspension of Block System)], notify MW employees in the affected territory. Release all track and time before CTC is suspended.

44.14 Adjacent Restricted Track

When TY&E employees request that train movement be restricted on adjacent tracks controlled by a BNSF train dispatcher/control operator, the following applies:

- Train dispatcher/control operator to brief with the requesting employee on tasks to be performed and determine if conditions allow the work to be performed on the side opposite where a train may approach on the adjacent track.
- If tasks can be performed on the side opposite, the tasks are to be performed in that manner.
- When advised by the employee that tasks cannot be performed on the side opposite where a train may approach on the adjacent track, issue track and time for the limits identified. For the address, use the identification of the train the requesting employee is assigned to.
- If a train is authorized through the identified limits, do not issue track and time contingent upon a condition. Issue only after any train movement authorized is physically passing or has passed the location where the track and time will be used.

Placement of a track block only to protect a TY&E employee request to restrict train movement on an adjacent track is prohibited.

Note: This rule does not apply when a passenger train crew member requests protection to load / unload passengers. Refer to TDCOM 40.22.3 for instructions pertaining to protection of passenger trains loading/unloading passengers.

44.15 Relinquish Control of CTC Machine

When requested and as time permits, give control of the CTC control system to signal technicians for testing/cutover purposes.

Prior to using the CTC control system to affect signals, switches, or track blocking, CTC Signal Supervisors/Technicians will obtain approval from the control operator.

Use of CTC control functions that do not affect signals, switches, or blocking do not require prior approval.

44.16 Protection for Occupied Outfit Cars

When providing protection for occupied outfit cars, as outlined in GCOR 5.12, make a record on the form provided.

44.17 Reserved for Future Use

44.18 Protection of Maintenance of Way in Manual Interlockings

Issue track and time for all MW movements or work within manual interlocking limits (including foreign line tracks and MW employees).

Exceptions:

- A Form B track bulletin restriction is used,
or
- Division specific instructions are issued which explain the method in which MW employees will be protected within the specified interlocking.

44.19 Change of Direction

44.19.1 Change of Direction within a Control Point or Manual Interlocking

When the trailing end of a movement stops within a control point or manual interlocking, permission to change direction or multiple changes of direction, e.g. switching, may be granted when the following conditions have been met:

- Conflicting movement has been stopped.
- All programmed switch and signal requests have been canceled.
- Blocking has been applied to affected switch(es).
- Track block(s) or restrictive tag(s) have been applied to the affected track segments.

Protection must be maintained until a job safety briefing between the train dispatcher and crew confirms that the train is clear of the control point and permission for change of direction is complete or cancelled.

44.19.2 Change of Direction Outside of Control Points or Manual Interlockings

Before authorizing a change of direction to a train that has entered a block on signal indication:

- Verify no conflicting authorities exist.
- Apply track block to affected limits.

Grant verbal authorization in the following format:

“(Train) has authority to proceed (direction) on (track)”.

44.20 Control Tower Emergency Bypass Switches / Devices

Emergency bypass switches and devices should be locked or sealed at all times. Immediately notify the Signal Call Desk when the seal must be broken in cases of emergency.

Inform the Signal Call Desk that signal maintenance personnel are to be called to examine the signal appliances and reseal the emergency bypass switches and devices.

44.21 Train Entering Track within CTC or Manual Interlocking

When a train is authorized to enter a track within CTC territory or Manual Interlocking limits, verify that there are no conflicting movements before granting authority. Do not grant authority contingent upon a condition.

Note: See GCOR 9.17, 10.1.

Apply track block(s) to the affected location until the movement has entered the track and is protected by block system occupancy.

Granting Authority to Enter Track Ahead of Another Train In CTC

When a train is delayed within a block and the control operator desires to allow another train to enter the track from an auxiliary track, between the delayed train and the next controlled signal, for purposes other than switching the delayed train:

- Verbally instruct the crew of the delayed train to Stop their train if not already stopped and not move their train until authorized to do so by the control operator.
- Do not allow the crew of the delayed train to move their train until the other train has entered the track and has passed the next controlled signal or the control operator has contacted the other train and ascertained the rear of their train is beyond the next governing signal.

44.22 Reserved For Future Use

44.23 Locomotive Set Out On Line

Permission to Set Out Locomotive On Line

Before a locomotive is set out on line for a mechanical defect, report the issue including locomotive number, location of train (subdivision, nearest station) to the Chief Dispatcher and respective mechanical desk via CAD IM. Further actions regarding the locomotive will be governed by mechanical desk personnel instructions.

Exception: If a mechanical employee is on site and advises that a locomotive needs to be set out, it is not necessary to obtain mechanical desk instructions to set the locomotive out.

Setting Out Identifying Locomotive

In CTC territory, when a train sets out the identifying locomotive, train dispatcher must instruct the crew to change the address of their general track bulletin to the new identifying locomotive number.

44.24 Signal Testing Instructions

When signal department employees request permission to perform testing of signal equipment that does not require fouling a Main Track or controlled siding, and traffic conditions permit:

- Brief with the employee to obtain a common understanding of what tracks, routes and signals will be affected.
- Apply track block(s) to the affected track(s) or control point(s) to prevent train movement into the affected area.
- Maintain track blocks until employee advises testing is complete.

Note: In locations equipped with field blocking it may be necessary to utilize signal blocks to prevent train movement into the affected area.

Testing with Jumper/Plug Coupler

Signal personnel have the capability to perform maintenance/testing on dual control crossover switches in control points not equipped with Independently Controlled Switches (ICS) without affecting the signal system on the adjacent track by using a device called a jumper (or plug) coupler, also referred to as an isolation unit.

When signal personnel request switch block(s) be placed on a specific switch of a crossover at a control point not equipped with ICS for the purpose of maintenance/testing with the use of a jumper/plug coupler, the dispatcher must:

- Repeat the request to confirm a common understanding, determining specifically which switch of the crossover the jumper/plug coupler will be applied.
- Apply an OS block to the affected track assuring the OS block includes a device block on the affected switch. Identify the OS block with "(Employee's last name) - jumper applied (track)" to designate on which switch the jumper/plug coupler was applied. Track and time blocking does not fulfill this requirement.
- Confirm with the signal employee block has been applied, specifying which switch is blocked.
- Maintain OS block until a job safety briefing has occurred with the signal employee indicating the jumper/plug coupler has been removed. OS block may only be removed after this briefing confirms the jumper/plug coupler has been removed.

Communication regarding application or release of switch blocking for this purpose may be conducted verbally or by Smart Mobile Client messaging, but must be conducted separately from a track and time request and only after track and time has been granted at the control point affected.

When jumper/plug coupler is used in combination with permission to take the affected switch into hand operation, it is not necessary to apply track block(s) to adjacent tracks.

This page left blank intentionally

45.0 Track and Time

45.1 Recording Non-Computerized Track and Time

When issuing non-computerized track and time, record the required information on the form provided.

When using a computerized track and time system, an automatic record is generated and paper form is not required.

45.1.1 Extend Time Limits

To extend the time limits on the track and time form:

- Use a red pencil to draw a line through the until time.
- Write the new time in Time Extended column.
- If time is extended by someone other than the issuing control operator, write the initials of the control operator who issues the new time next to the extended time.

When extending track and time, use the following words:

“(Name or Equipment), authority number (number) is extended until (time)”.

45.1.2 Authorized Limits

Do not change the authorized limits of a track and time authority in effect. Issue a new track and time authority if the holder needs different limits.

45.2 Issuing Track and Time

45.2.1 Track and Time Request

Require an individual requesting track and time to state the following:

- Name.
- Occupation.
- Location on the Main Track or controlled siding or where track will be entered. Confirm the point of entry is within current authority or requested limits.
- Train or other identification.

Instruct employee requesting track and time to call back at a given time if track and time cannot be granted for immediate use.

45.2.2 Protecting Limits and Movement

Confirm Blocking

Before transmitting track and time, confirm track block(s) have been applied on the control system to prevent movement into the authorized limits while track and time is in effect.

On track segments where another control operator provides any part of the track block(s), get confirmation that the adjacent control operator has applied track block(s) before transmitting track and time.

Track Indications in Control Points

Before granting track and time to employees when the requested limits are entirely within a control point or include a control point at either end of the limits determine if their work will cause a track indication in the control point.

If their work will not cause a track indication in the control point, it is only necessary to apply track block(s) for the track and time authority.

If their work will cause a track indication in the control point, do the following:

- Apply track block(s) or restrictive tag(s) to the adjacent track segment(s) in both directions.
- Allow no train or engine movements into the adjacent track segments unless under track and time or advice of the work being performed in the affected control point is given.
- When permission to operate dual control switches is included, apply track blocks to all track segments affected in both directions.

Note: Requirements for track indications in control points does not apply at control points where Independently Controlled Switch (ICS) is in effect.

Standing Equipment in Limits

When track and time is granted in the same area as standing equipment (tied down train - no crew, cut of cars, etc.), job brief with the track and time holder as to the location and status of the standing equipment.

Contingent / Behind Authorities

Do not issue track and time authority contingent upon a condition. Issue only after any train movement authorized is physically passing or has passed the location where the track will be entered. If track entry location is between the same control points that the train movement(s) is/are between, determine each train's location by direct radio contact or by confirmation from field employee of visual identification of train(s).

If the authority issued to a MW employee contains overlapping authority with a train, use "Behind (train)" to instruct the employee that authority is granted behind the train movement(s).

If track and time cannot be granted account train(s) are still approaching the track entry location, instruct employee when to call back.

45.2.3 Locations Used for Track and Time Issuance

When authorizing limits, use defined points such as signals, switches, or track and time points.

Switch

When a switch is used to designate a point, the switch is not included in the limits (Switch/No).

For example:

Between WSS Walker and ESS Bill.

(Between West siding switch Walker, Switch/No and East siding switch Bill, Switch/No).

Signal

When a signal is used to designate a point, the switch is included in the limits (Switch/Yes).

For example:

Between WBCS Jane and EBCS Mitchell.

(Between Westbound Control signal Jane, Switch/Yes and Eastbound Control signal Mitchell, Switch/Yes).

Track and Time Point

When a Track and Time Point is used to designate a point, switches between each designated point are included.

For example:

Between T&T Point 1 and T&T Point 2.

(Between Track and Time Point 1 and Track and Time Point 2).

45.2.4 Granting Track and Time

When granting track and time, use the following verbiage:

“(Name or Equipment), authority number (number) granted on (track) between (location)(switch y/n) and (location)(switch y/n), until (time)”.

When employee has repeated the above correctly, respond with the following:

“(Number) is OK at (time), (Control Operator initials)”.

45.2.5 Loss of Communication

If track and time authority is transmitted and communication is lost before the employee repeats the authority or if an incomplete message is received during the repeat, consider the authority in effect until communication is restored. Complete the track and time authority and maintain track blocking in the control system. When communication is re-established between the control operator and field employee, the track and time must be repeated or released. When the field employee repeats the track and time, access the track and time record and use this information to verify the repeat is correct.

45.2.6 Reserved for Future Use

45.2.7 CTC Outage (Code Brown)—Issuing Track and Time

If a CTC outage (code brown) occurs and trains are in or authorized through the affected territory, do not issue any track and time authority until the limits can be protected.

Before granting track and time, consider that the control machine display of the affected control point and the signal indications in the field may not correspond.

If possible, utilize the CTC control equipment to issue track and time in normal manner.

If unable to issue track and time in normal manner:

- Ensure no train movements are within or authorized through the affected territory unless granted joint track and time.
- Apply track block(s) at adjacent control points to prevent access.
- Issue track and time using form provided.
- Number consecutively, beginning with authority number 1 on each dispatcher district.
- Archive the form when all authorities are released.

Note: If train movements are authorized through the affected territory and it is necessary to issue track and time to a MW employee, contact each affected train, inform crew of the situation and advise each train to immediately reduce to Restricted Speed confirming when they have complied. Place track blocks devices and issue joint track and time to each of the affected trains. After issuing joint track and time to each train, place track blocks and issue joint track and time to the MW employee.

45.3 Joint Track and Time

45.3.1 Same or Overlapping Limits

Non-computerized Track and Time

If more than one track and time authority is issued in the same or overlapping limits, all track and time authorities in those limits must be joint. This applies regardless of whether the track and time is for trains, MW, or any combination (trains and trains, trains and MW, MW and MW).

45.3.2 Notification of Joint Status

First Authority Holder

When issuing track and time authority in limits where no track and time authority currently exists, but in which other authorities are anticipated in the same or overlapping limits, make the first authority "joint". Do so by issuing in the following manner:

"(Name or Equipment), authority number (number) granted on (track) between (control point) (sw y/n) and (control point)(sw y/n) joint until (time)".

If the track and time authority already exists as a sole authority and other authorities need to be issued in the same or overlapping limits, contact the holder of the first authority and modify the sole authority to joint status by issuing the following:

"(Name or Equipment), authority number (number) is now joint".

Additional Authority Holders in the Same or Overlapping Limits

When issuing track and time authority in the same or overlapping limits where "joint" authorities already exist, advise the new authority holder of each party already occupying the limits. Do so by including in the new track and time authority the name or equipment ID of each party already occupying the limits as follows:

"(Name or Equipment), authority number (number) granted on (track) between (control point) (sw y/n) and (control point)(sw y/n) joint with (party 1), (party 2), and (party 3), until (time)".

45.4 Reporting Clear

Include the following elements in the report clear dialog when an employee or train releases track and time:

- The employee's name or train's identifying initials and engine number.
- The authority number.
- The track limits of the authority.
- The time authority is released.
- The question, "Is that correct".

For example: "BNSF 1234 reporting clear on authority 56-78 between CP 5432 and CP 5365 at 1345. Is that correct, over".

When the release language is generated by a control system, read the verbiage as presented in the dialog box, adding any elements necessary to ensure all the above elements are included in the dialog.

(Note: Verbiage presented by various control systems may vary).

45.5 Releasing Track and Time to Move on Signal Indication

Include the following elements in the dialog when a train releases track and time to move in a specified direction governed by signal indication, as outlined in GCOR 10.3(C):

- The train's identifying initials and engine number.
- The authority number.
- The track limits of the authority.
- The time authority is released.
- The specific direction the train is to move.

For example: "BNSF 1234 releases authority 56-78 between CP 5432 and CP 5365 at 1345 for movement eastward, over".

When the release language is generated by a control system, read the verbiage as presented in the dialog box, adding any elements necessary to ensure all the above elements are included in the dialog.

Note: Verbiage presented by various control systems may vary.

45.6 Switch Lined and Locked

If a switch or derail within track and time does not indicate to be lined and locked for the intended route, instruct the train or employee to operate the affected switch or derail by hand for the route.

Do not operate a dual control switch or derail within track and time limits without ascertaining it is safe to do so from the track and time holder or an employee physically at the switch.

46.0 Reserved for Future Use

47.0 Reserved for Future Use

This page left blank intentionally

48.0 Switch Control and Monitoring Systems

48.1 Remote Control Power Switch (RCPS)

Remote Control Power Switch (RCPS) allows the train dispatcher to remotely control switches and monitor switch position in non-signaled TWC territory.

This system consists of dual control switches controlled by the train dispatcher without signals in the field authorizing or governing movement over the switches. RCPS circuit will be designated by signs in the field. When report is received or train dispatcher becomes aware a train has passed a RCPS sign without authority:

- Advise train involved to Stop and remain stopped until further instructions are received from the Chief Dispatcher.
- Promptly notify the Chief Dispatcher.

The following applies when the RCPS system is in effect:

Alerts

The train dispatcher will receive an alert if a train has authority over a RCPS and the status of the switch changes to out-of-correspondence (indeterminate). When an alert is received or an unidentifiable track indication appears on the switch:

- Promptly determine the location of the train with authority over the identified switch.
- If the train has passed the identified switch, perform a track release to cancel the alert.
- If the train is closely approaching (7 miles or less) the identified switch, the train dispatcher must notify the crew to Stop short of the switch, consistent with good train handling. This instruction may be given verbally.
- If the train is not closely approaching (more than 7 miles) the identified switch, issue a new track warrant to the affected train that voids the authority over the switch and ends the authority at the alerting switch.
- Work between authority issued to trains must end at any out-of-correspondence switch or switch with an unidentifiable track indication.

After the train is stopped at the out of correspondence switch authority may be issued beyond the switch with instructions to hand operate the switch. Before granting instructions to hand operate the switch apply switch block to the switch to prevent movement requests.

MW Employees

The following applies to MW employees:

- MW employees must be granted authority to occupy or perform maintenance on the Main Track within the RCPS circuit.
- The system will not alert for MW authorities over RCPS.
- The position of a RCPS can be changed when requested to do so by MW employee and after answering prompt.
- If Form B includes one or more RCPS, job briefing and switch blocking as required by TDCOM 43.10.1 (Dual Control Switches Within Form B Limits) applies.

Additional Instructions

- Track indications received over a RCPS must not be used to track release a track warrant authority.
- Promptly report an alerting switch to the Signal Call Desk and the Chief Dispatcher.
- Additional instructions regarding RCPS are contained in the System Special Instructions.

48.2 Switch Point Monitoring Systems (SPMS)

Switch Point Monitoring Systems (SPMS) is a program that will alert the train dispatcher when a Main Track switch may not be properly lined for an approaching train in non-signaled territory.

The following instructions supplement current SPMS instructions contained in System Special Instructions and apply when the system is in service.

Alerts

The train dispatcher will receive an alert if a train has authority over any equipped switch that changes status from the normal position. Alerts will occur if a switch is reversed or its position becomes unknown (indeterminate).

Exception: An alert will not occur for trains operating with a proceed track authority (box 2) for switches located in the "from" and "to" locations of their authority.

When an alert is received:

- Promptly determine the location of the train with authority over the alerting switch.
- If the train has passed the alerting switch, perform a track release to cancel the alert.
- If the train is closely approaching the alerting switch (7 miles or less), the train dispatcher must notify the crew using the appropriate verbiage in the dialogue box presented. This notification may be issued verbally.
- If the train is not closely approaching the alerting switch (more than 7 miles), the train dispatcher is required to issue a new track authority to the affected train that restricts authority to the alerting switch.

Authority may be issued beyond the indeterminate switch only after employee has verified the switch is in normal position by performing an on-ground inspection.

Note: Work between (box 4) authority for trains must end at any indeterminate switch.

The train dispatcher is prohibited from issuing two work between (box 4) authorities to the same train that make the limits of authority end-to-end. (Example: Do not issue track authority #1 with work between (box 4) Anna and Bess and track authority #2 with work between (box 4) Bess and Cloy).

Protect Open Switch

Where Protect Open Switch is in effect, information received from the Switch Point Monitoring System regarding position of switch(es) must not be used to change the indicated position of a reversed Main Track switch(es) protected by a track warrant. Refer to TDCOM 42.19 for proper process to indicate Main Track switch(es) to normal position.

Verified Normal

When a crew member or MW employee reports an alerting switch to be in the normal position, the train dispatcher will indicate the switch to be in the "Verified Normal" position. When a switch status is changed to the "Verified Normal" position, the switch position reporting system status display will indicate the switch as "Verified Normal". The switch will remain in this status until a new status report is received from the equipment in the field. While the switch is in the "Verified Normal" status, subsequent authorities can be issued over the switch without restriction. The train dispatcher must not "normal" the alerting switch until it has been inspected by a field employee.

Reporting Alerts

Promptly report any SPMS alerting switch to the Signal Call Desk and Chief Dispatcher.

48.3 Track Integrity Warning System (TIWS)

The Track Integrity Warning System (TIWS) checks the rail for continuity and alerts the train dispatcher to possible track occupancies or defects (e.g. broken rail) in non-signaled territory.

The following instructions supplement current TIWS instructions contained in System Special Instructions and apply when the system is in service.

Alerts

Alerts will be generated to the train dispatcher when occupancy is detected within a zone(s) not corresponding in proper sequence with an authority issued on that segment of track. Such alerts are referred to as "Track Integrity Down" (TID) and will be communicated by the train dispatcher to trains authorized within the zone(s).

When an alert is received:

- Promptly determine the location of the train with authority over the alerting zone.
- If the train has passed the alerting zone, perform a track release to cancel the alert.
- If the train is closely approaching the alerting zone (7 miles or less), the train dispatcher must notify the crew using the appropriate verbiage in the dialog box presented. This notification may be issued verbally.
- If the train is not closely approaching the alerting zone (more than 7 miles), the train dispatcher is required to issue a new track authority to the affected train that restricts authority to the alerting zone. After the train is less than 7 miles from the alerting zone, a new track warrant including "TID" information in box 14 (other instructions) may be issued. The limits of this authority must start at the beginning of the alerting zone; however, the limits of authority may extend beyond the alerting zone.

Reporting Alerts

Promptly report any TIWS alert to the Signal Call Desk and Chief Dispatcher.

This page left blank intentionally

49.0 Train Control Systems

49.1 Positive Train Control (PTC) and TWC Plus Territory

The following instructions apply on all subdivisions where Positive Train Control (PTC) or TWC Plus technology has been implemented.

Movement of Trains Not Equipped with PTC or Inoperative PTC

Unless permitted by GCOR 18.13 or timetable instructions, brief with the Chief Dispatcher when a train not equipped with PTC or with inoperative PTC is operating on your PTC territory.

When approval from the NOC GDT (or their designee) is required to operate a train without PTC, the train dispatcher must receive approval information by phone or CAD IM.

Note: Movements of self-propelled maintenance equipment (such as rail grinders), either performing work or operating as a train, are not required to be equipped with PTC.

Inoperative PTC

If any PTC equipped locomotive is unable to download any bulletin, notification, and/or authority, instruct crew to contact the PTC Desk.

If electronically delivered bulletins, notifications, and/or authorities were copied on the prescribed form by the crew prior to PTC becoming inoperative, confirm accuracy of the bulletins, notifications, and/or authorities using abbreviated verbiage as prescribed in TDCOM 42.9 / 43.18.1, unless the information has been previously confirmed or the crew verifies the information is viewable in iGTB.

If electronically delivered bulletins, notifications, and/or authorities were not copied on the prescribed form by the crew prior to PTC becoming inoperative, reissue information using the verbal transmission repetition process prescribed by TDCOM 40.7 and GCOR 2.14.1.

If a train experiences issues with their onboard PTC equipment or a field device improperly reporting, notify the Chief Dispatcher and instruct the crew to report the issue to the PTC desk unless they have done so already.

Speed Restrictions

When a restrictive "SPEED" tag is made non-restrictive, the speed restriction information is removed from the PTC train's onboard system, unless the restriction has been entered in GRIT.

If a speed restriction is not entered in GRIT, restrictive tag(s) for the condition must remain in the "restrictive" state until voided or issued as a speed restriction in GRIT and delivered to all trains.

Crossing Warning Notifications

Restrictive and non-restrictive "XING" tags are delivered to the PTC onboard system and enforced by PTC.

Crossing Warning Notifications protected by an INFO tag are not delivered to the PTC onboard system and will not be enforced by PTC.

Pass Stop Indication (PSI)

In CTC territory, when verbally authorizing a train to pass a Stop indication, the Pass Stop Indication (PSI) function in the control system must be used. Proper track blocks must be placed prior to authorizing the movement.

In ABS territory, when verbally granting permission to pass a Stop indication, the Past Stop Indication (PSI) function in the control system must be used. The train symbol must be moved to the track segment adjacent to the location of the signal displaying Stop prior to using the PSI function.

Enter Controlled Track (ECT)

When verbally authorizing a train to enter CTC limits, the Enter Controlled Track (ECT) function in the control system must be used. Proper track blocks must be applied prior to authorizing entry.

49.2 PTC Wayside Repair Instructions

When a telecom or signal department employee requests protection in the control system to repair or test PTC wayside (radio) equipment, without fouling a Main Track or controlled siding, and traffic conditions permit:

- Brief with the employee to obtain a common understanding of the affected track limits.
- Confirm no trains are operating within or authorized to enter the affected limits.
- Apply track blocks or tags to all controlled tracks in the affected limits to prevent train movement into or within the affected area without proper notification.
- Advise the employee that protection has been applied.
- Maintain track protection until employee advises testing or repairs are complete.

If traffic conditions require that trains continue to operate in the affected limits while the PTC wayside is temporarily offline:

- Notify affected trains "PTC wayside is temporarily offline at (location). Reduce to 20 MPH."
- Confirm with affected trains that they have complied with 20 MPH before advising telecom or signal employee that track protection has been applied.

50.0 Train Dispatcher Transfers

50.1 Responsibilities of Train Dispatcher Being Relieved

Generate a transfer page prior to being relieved.

On the transfer page, include the following information:

- Handwritten track authorities in effect.
- Explanation of any restrictive tags or blocks that exist at time of transfer.
- Notation of any unusual conditions or restrictions in effect requiring protection.
- Notation regarding any crossing warning notification conditions in effect, including crossing(s) equipped with automatic warning devices and/or passive warning devices. Include notification regarding trains affected, but not notified, and how access is being restricted and notification provided.
- Track bulletin restrictions not delivered to trains that have already received a general track bulletin. Indicate these track bulletin restrictions by listing trains needing the restrictions.

Note: Electronic transfer (ET) will automatically develop the list of trains needing track bulletin restrictions from the dispatcher task list (DSTL).

- List of all trains that:
 - Were not delivered an electronic GTB,
 - or
 - Have changed train symbols since the crew received a GTB and GTB has not been updated to new symbol.
- Relief crews or short turn crews that have received a GTB addressed to a symbol other than the train symbol the crew will relieve, include:
 - Crew names and time on-duty.
 - GTB number and train symbol (including "N" symbol) addressed on GTB.
 - Train symbol of the train the crew is assigned to or planned to be assigned to. (Example: Condr. Jones, Engr. Smith o/d 1000 cleared with GTB 12345 as N-KCMKCM6-08 on train M-LINTUL1-02, BNSF 4565—need to manually track for any new restrictions).
- Any information that would benefit the relieving train dispatcher.

Sign the transfer when it is prepared and ready for relieving train dispatcher. After signing the transfer, responsibility for the position remains with the train dispatcher being relieved until the relieving train dispatcher signs the transfer page. Remain until the relieving train dispatcher accepts and signs the transfer. At this point, time the transfer and relinquish dispatching duties to the relieving train dispatcher.

Log off the traffic control systems, CAD, and TSS prior to departure from workstation.

50.2 Responsibilities of Relieving Train Dispatcher

50.2.1 Review Instructions

Before beginning work each day, review General Orders (System & Division), General Notices (System), Dispatcher Notices, Control System Notices and other instructions for the territory being handled.

At least once during each shift, review electronic mail for new messages. Do this at the first opportunity as job briefings and other pertinent instructions are delivered in this medium.

Log on to train dispatcher train control systems, CAD, TSS and communication devices, ensuring proper dispatcher workstation number and/or territory responsibilities are entered for the shift being worked.

50.2.2 Understand Instructions

Complete transfer as follows:

- Review and understand all restrictions, instructions and authorities in effect at the time of transfer.
- Read and initial any handwritten instructions or authorities such as:
 - Track warrants or track bulletin restrictions that have been issued.
 - Blue signal and occupied outfit car protection.
 - Other pertinent instructions (one set of initials for all other pertinent instructions).
- Retain and archive the dispatcher transfer in the dispatching district's archive folder.
- Verify track blocks and/or restrictive tags are placed correctly for required conditions such as, but not limited to:
 - Speed restrictions.
 - Crossing warning notifications.
 - Dual control switches within Form B limits.
 - Track or switches out of service.

50.2.3 Understand Track and Time

The relieving train dispatcher will read all handwritten track and time in effect. To indicate understanding of all handwritten track and time in effect, write initials on the line directly below the last authority issued.

Signing and timing of the transfer will indicate understanding of all computerized track and time in effect.

50.2.4 Reserved for Future Use

50.2.5 Time and Sign

To accept responsibility for the position, the relieving train dispatcher must time the transfer page at the exact time the transfer is started. When transfer is completed, relieving train dispatcher must sign the transfer page to signify acceptance of the transfer.

Student and qualifying train dispatchers must sign and enter time on the transfer indicating on-duty and off-duty times.

All times entered will be used for Federal Hours of Service records. Time off-duty before showing on-duty must be entered. Time off up to 99 hours must be precise (Example: 15 hours 5 minutes). Time off over 99 hours may be shown as 99+.

When receiving transfer during shift (Example: A train dispatcher is slid to another desk after shift has started or a second shift train dispatcher takes transfer from a split territory with overlapping work hours.), time and sign that transfer in the space provided and write "Continuous" in the Hours Off Since Previous Shift space.

This page left blank intentionally

51.0 Train Dispatcher Records

51.1 Maintain Records

Maintain neat, accurate, and legible records.

51.2 Retain and Archive

Documents that must be retained and archived are:

- Train Movement Records(handwritten).
- Track Bulletin Restrictions (handwritten).
- Track Warrants (handwritten).
- Track and Time records (handwritten).
- Train Dispatcher transfers.
- Unattended Key Train Briefing Form.
- Notification lists of train crews notified of crossing warning malfunction, activation failure or disabling by other than Form C track bulletin restriction or track condition message.
- Blue Signal Protection Form.

All required information must be recorded on the prescribed form.

In addition, retain at each dispatching district desk computer-generated hard copies of current track bulletin restrictions for the territory. It will not be necessary to archive these hard copies when voided or replaced with a more current version.

51.3 Initials

When training or qualifying on a position, use only the initials of the train dispatcher responsible for the territory on all records.

51.4 Reserved for Future Use

51.5 Verbal Transmission

When verbally transmitting track bulletin restrictions, track warrants and track and time, do the following:

- Ascertain who is copying the document before transmitting.
- Regulate the speed of the transmission to ensure that the receiving employee can copy it.
- Record the required information on the form provided and read aloud all applicable preprinted and written instructions.
- Make sure the employee copying repeats all applicable preprinted and written instructions.
- Confirm information repeated is correct.
- Underscore each written word and figure each time it is repeated when using handwritten forms.

51.6 Numbering

The following handwritten mandatory directives must be numbered:

- Track bulletin restrictions.
- Track warrants.
- Track and time.

Assign numbers by adding two digits to the dispatching workstation number preceded by the letter "V", beginning with 01 each day at midnight. For example, if working Ft Worth West, DS55, the first handwritten instruction number of the day would be V-5501. If working Lampasas, DS24, the first number would be V-2401, etc.

The exception to the process above is when track bulletin restrictions have been entered in GRIT or when a six-digit number is created by TMDS for a speed tag. In this instance, use the track bulletin restriction number generated in TSS or if the speed restriction is temporary and protected by a restrictive tag then use the six-digit number generated by TMDS for the tag as the number on the handwritten form.

Do not have duplicate numbers in effect at the same time.

51.7 Track and Time No Longer in Effect

When handwritten track and time is no longer in effect:

- The initials of the train dispatcher responsible for the territory must be written legibly across the number with a red pencil and draw a red line through the entire entry.
- Draw a red diagonal line across the page to indicate that all items on that page are no longer in effect.
- Draw a red X across the entire page when all items to and including that page are no longer in effect.

52.0 Dispatcher Train Movement Records

52.1 Current Train Movement Record

Keep the train movement record current. Carefully check entries made on the train movement record, including entries made by preceding train dispatchers. Secure and enter missing information on the train movement record, even if the event occurred on a previous tour of duty. Where written train movement records are maintained, enter all information in a neat and orderly manner in ink and sign the train movement records.

52.2 Train Movement Record Information

The Code of Federal Regulations (CFR) and BNSF internal requirements mandate the inclusion of certain information on the train movement record.

Include the following information on the train movement record:

- Identification of timetable.
- Location and date.
- Identification of train dispatcher.
- Dispatcher on-duty time.
- Dispatcher off-duty time.
- Track bulletin restrictions delivered to trains.
- Identification of engineer and conductor and their times on-duty and times due off on hours of service.
- Identification of trains and engines.
- Direction of movement.
- Connection (if applicable) and departure times at origin and arrival time at destination for each crew district.
- Number of loaded cars, empty cars, and total tonnage at the origin and destination station on each crew district for each train.
- Duration and explanation of delays.
- Set out information for any bad order car set out on line.

Note: Input fields for the required information are presented by CAD function “Detector Stop” (DS) for bad order set outs associated with a trackside warning detector (TWD) stop and by “Other Mechanical Stop” (OT) for bad order set outs not associated with a TWD. Proper completion of these functions provides automatic notification to Resource Protection and the Mechanical Desk.

In the event of a catastrophic loss of the electronic system of train movement records (CAD), the preceding information must be hand recorded on paper and filed for archival.

52.3 Authority Issued and Movement Complete

After issuing authority for train or MW movement, immediately draw a red diagonal line in the appropriate column on the “TRAIN” line.

When the movement is complete, draw another red diagonal line to form an “X”.

When using the CAD system, this rule does not apply.

52.4 Transfer to Next Day's Train Movement Record

Transfer trains to the next day's record if they are entered on the train movement record before midnight but do not depart the initial station or turnaround point until after midnight. When transferring these trains, write the following:

- Transferred to train movement record of (date).

When using the CAD system, this rule does not apply.

52.5 Crew Relieved at Other than Designated Terminal

When the Hours of Service Law causes a crew to be relieved at other than a designated terminal, note the information on the train movement record and indicate the time and location.

In the CAD system, this information is generated when relief crew is applied to train movement record.

52.6 Reserved for Future Use

52.7 Issue Initial Track Warrant or General Track Bulletin

When issuing an initial track warrant or general track bulletin, including in CTC territory, to a train, as outlined in GCOR 15.1 (Track Bulletins), draw a circle that contains the track warrant or GTB number in the "Train" column.

In the CAD system, this function is not required.

52.8 TWC Territory

In TWC territory, when a crew member reports to the train dispatcher the exact time the rear of the train has passed a specific point, do the following:

- State the track release information followed by, "**Is that correct?**".
- Include the information on the train movement record.

52.9 Train Movement Records in TWC Territory Not Protected by a Track Warrant Control Computer System

Before giving the OK for track warrants issued to trains or MW employees in TWC territory not protected by the TWC computer system, enter the following train movement record information:

Movement Authorized in One Direction

To indicate the limits of authority for trains and MW employees authorized to move in one direction only, draw a vertical line between the stations authorized. Also between the limits authorized, draw a circle that contains the track warrant number.

A horizontal line in the column at the last named point indicates “Hold Main Track” at that point.

An arrow in the column at the last named point indicates “Clear Main Track” at that point.

Movement Authorized Against Current of Traffic

In double track, when authorizing movement against the current of traffic, draw horizontal red lines in the “MW employee” or “Train” column to indicate between which stations movement is being made.

Movement Authorized in Both Directions

Single Track. To indicate the limits of authority for a MW employee or train authorized to move in both directions, draw a diagonal line between the stations authorized under the entry for the MW employee or train. Do this on both sides of the column.

Between the limits authorized, draw a circle that contains the track warrant number.

Double Track. If a MW employee or train is authorized to move in both directions, show the limits of authority only on the side of the train movement record that corresponds to the track authorized.

52.9.1 Track Warrant Void or Reported Clear

When a track warrant has been made void or reported clear, draw a red “X” through the track warrant number on the train movement record.

52.9.2 Locations Not Shown in Station Column

If track warrant limits are other than the stations shown in the station column (such as MP, DT, XO, or YL), indicate the location in the appropriate column.

This page left blank intentionally

53.0 Track and Weather Conditions

53.1 Adverse Conditions

53.1.1 Delivering Notification of Adverse Condition(s)

When notified of an adverse condition that may endanger the safety of employees or others, or may present a hazard to safe operation of trains, the train dispatcher / control operator must:

- Isolate the affected area.
- Use the quickest means of communication available to give immediate notification to all concerned.

53.1.2 Unusual Track Condition

When report of unusual track condition is received:

- Restrict access to the condition by placing restrictive tag(s) or track block(s) to the area where the condition exists.
- Report the condition, during normal working hours, to the Roadmaster or MW employee in charge of the territory. After normal working hours or when there is a problem contacting MW Personnel, report the condition to the NOC MOW Help Desk.
- Report the condition to the Chief Dispatcher/local supervisor.
- Unless the reported condition is impassable, such as a report of broken rail or thermal misalignment, until other instructions are received from the NOC MOW Help Desk, Roadmaster or MW employee in charge of the territory, verbally instruct trains to proceed at Restricted Speed and not to exceed 20 MPH until entire train has passed through the location indicated.

Example

“(Engine ID), between MP X.X and MP X.X, proceed at Restricted Speed and do not exceed 20 MPH until the rear of your train is clear of the limits”.

- Maintain protection of the affected area until the condition is repaired or NOC MOW Help Desk, Roadmaster, or MW employee in charge provides other operating instructions.

Prioritize track inspection by stopping approaching traffic when engineering employee(s) arrive onsite.

Operating over a broken rail or thermal misalignment requires permission from a qualified Engineering Department employee (MW or Signal) at the location.

Insulating Commodities

When report of insulating commodities, such as clay, chips, oil, etc. on top of rails or leaves covering the rails is received:

- Ascertain the MP location(s) of the condition.
- Notify trains in the area to approach road crossings at grade equipped with automatic crossing warning devices prepared to stop until it is determined that the warning devices are operating properly.
- Issue a malfunctioning crossing warning protection (Box 2) for crossings within 1 mile on either side of the reported condition.
- Notify the Signal Call Desk.
- Maintain protection until notified that protection is no longer needed.

53.1.3 Unusual Switch Condition

Switch Hard-to-Throw

When a report of a hard-to-throw switch is received:

- Issue a Form C (main track or siding switch) or TCM (other than main track switch) with the verbiage: "At (location) switch (name or other identifying information) is out of service account hard-to-throw".
- Restrict access by placing an INFO tag. Tag may be removed once all affected trains have received the Form C or TCM:
- Report the issue to the NOC MOW Help Desk.

Frozen Switch

When ice or snow is affecting a switch and a train crew cannot sufficiently clean the switch to facilitate hand operation, immediately report the condition to the NOC MOW Help Desk.

53.1.4 Track Obstruction

When notified of a track obstruction such as slides, rocks, debris or other obstruction (Example: vehicle) affecting a Main Track or siding:

- Restrict access to the condition by placing restrictive tag(s) or track block(s) to affected track(s).
- Report the condition to the NOC MOW Help Desk and Chief Dispatcher / local supervisor.
- Verbally instruct trains that will traverse by the reported location using the format below. If the initial report did not include a specific mile post location, include a one-mile buffer on either side of the reported location when notification is given to trains.

Example (specific location):

"(Engine ID), at MP X.X, be governed by GCOR 6.21.3, due to a report of (obstruction)."

Example (one mile buffer):

"(Engine ID), between MP X.X and MP X.X, be governed by GCOR 6.21.3, due to a report of (obstruction)".

Note: The intended purpose of the buffer is to establish specific limits for the train crew to restrict operations when an exact location is not given in the initial report or when there may be confusion regarding the exact location.

- Notification to subsequent train is not required if train crew or BNSF personnel has traversed or released the area, including the buffer zone, and has reported the track to be clear.
- If an obstruction is confirmed, maintain protection of the affected area until MW personnel has released the affected track(s) for movement.

53.1.5 High Water / Washout

When notified of high water or a washout affecting a Main Track or siding:

- Ascertain from the source:
 - Mile post limits of water condition.
 - If water is standing or moving.
 - Water level (ex. bottom of the ballast, top of the ties, over the rail).
 - If any visible damage or threat to the track structure is present. (Examples: washout, side scour, surface irregularity, erosion at piers, footing, dump planks, walls, bridges, or debris against a bridge with active water flow).
- Restrict access to the condition by placing restrictive tag(s) or track block(s) to the area where the condition exists and on all controlled tracks in the area.
- Report the condition to the NOC MOW Help Desk and Chief Dispatcher/local supervisor.
- If any visible damage or threat to the track structure exists (see above), do not allow subsequent train movements through area unless approved by the Chief Dispatcher.
- Verbally instruct trains that will traverse the reported location (on any controlled track) using the format below.

Example:

“(Engine ID), between MP X.X and MP X.X, proceed at Restricted Speed and do not exceed 20 MPH until the rear of your train is clear of the limits account (moving/standing) water located at (bottom of the ballast, top of the ties, over the rail).”

- Maintain protection of the affected area until MW personnel has released the affected track(s) for movement.

Prioritize track inspection by stopping approaching traffic when engineering employee(s) arrive onsite.

53.2 Weather Conditions and Monitoring

Monitor weather conditions using equipment and/or software provided by the railroad.

When weather conditions restrict visibility, consult with the Chief Dispatcher or a division officer to decide whether it is necessary to restrict or prevent access to the location. When trains are stopped waiting for track inspection/release, they must not be allowed to proceed until conditions are known to be safe.

Types of Conditions

A WATCH/ALERT indicates where and when severe weather may occur. Train dispatchers are not required to notify trains or MW employees of watches/alerts, but should be aware of possible inclement weather conditions which may be encountered.

A WARNING means severe weather has been reported or will occur imminently; be prepared to take necessary precautions. Train dispatchers must deliver Warning information to trains and MW.

An EMERGENCY describes a condition which requires immediate action by the train dispatcher to notify train crews of imminent danger. Train dispatchers must deliver Emergency information to trains and MW. Emergency conditions must be given priority for delivery.

53.2.1 Delivering Notification of Adverse Weather Conditions

Once notified of a weather Warning/Emergency, the train dispatcher must:

- Isolate the affected area.
- Make a general broadcast stating Warning/Emergency type and limits using radio(s) within or near the affected area when multiple trains are within the affected area.

Note: The initial general broadcast does not relieve the train dispatcher/control operator from making the required notification to individual train(s) and/or MW employee(s).

- Communicate the Warning/Emergency individually to all trains and to those MW employees holding authority within the affected area.
- Notify the Chief Dispatcher when a train(s) is stopped due to weather conditions.

When the affected area of the weather Warning/Emergency overlaps adjoining train dispatcher territories, a job briefing must be held via CAD IM or recorded phone between the adjoining train dispatchers to establish:

- Common understanding of affected limits.
- Who is responsible for notifying which trains.
- Where staging locations will be, if necessary.
- What the operating plan will be.

Combining Limits of Existing Warnings/Emergencies

In the event multiple weather Warnings/Emergencies of the same condition are in effect simultaneously, the train dispatcher may combine Warning/Emergency notifications when communicating the Warning/Emergency to affected trains and those MW employees holding authority within the limits, provided:

- Weather Warning/Emergency limits are overlapping or contiguous (end-to-end),
and
- Approval is obtained from the Chief Dispatcher.

Do not combine Emergency weather notifications with Warning notifications.

Extending Warning Limits

When a weather Warning is received and it becomes apparent the weather system is following the path of the railroad tracks, with Chief Dispatcher approval, the train dispatcher may extend the Warning to include the entire subdivision or to the end of their territory prior to a Warning being generated for the extended area by the BNSF weather service provider.

When limits are extended by the train dispatcher/control operator:

- Isolate the extended area and notify all trains and those MW employees holding authority within the affected area.
- The limits must remain extended until the latest expiration time shown on the associated weather warning or until the weather warning is cancelled by the BNSF weather service provider.
- The extended limits must be included in the train dispatcher/control operator transfer.

Instructions Specific to Wind Warnings

- When excessive wind conditions require a train to stop within or prior to entering the High Wind Warning limits, brief with the Chief Dispatcher regarding the train prior to providing instructions for the train to proceed.

Cancellations

In the event a Flash Flood Warning/Emergency is cancelled after the indicated start time, continue notification and restrictions until track inspection has been completed and released by local MW personnel.

In the event a Tornado Warning is cancelled after the indicated start time, continue to notify trains until inspection has been completed by division employees or all of the limits of the Tornado Warning have been traversed by a train and confirmation received that no damage or unexpected conditions were observed.

53.3 Snow Removal Equipment

When a train is using snow removal equipment to plow snow, protect the head and rear of the train with absolute block protection.

When authorizing MW in the same limits and the MW personnel are on the train handling the snow removal equipment, one common authority may be given to the train for both the train and the MW personnel.

54.0 Rules For New Westminster Dispatchers

54.1 Rules and Instructions

The rules and instructions contained in the Train Dispatcher Control Operator Manual are intended to supplement the Canadian Rail Operating Rules (CROR) and must be applied in conjunction with them.

54.1.1 Terms (CROR Definitions)

The following table contains terms common to BNSF employees dispatching American territory and the associated terms used in Canadian territories:

U.S.A.	Canada
Bridge Operator	Signalman
Chief Dispatcher	Designated Officer
Control Point	Controlled Location
MW Equipment	Track Unit (TU)
Other Than Main Track	Non-Main Track (NMT)
Roadmaster	Engineering Supervisor
Track Block	Signal Block
Track Flag	Signal
Train Dispatcher	Rail Traffic Controller (RTC)

54.2 Review Email

Review electronic mail for new messages throughout the duration of the shift.

54.3 Daily Operating Bulletins (CROR 156)

Trains operating on the New Westminster subdivision are governed by BNSF General Track Bulletins (GTBs). When trains are operating over foreign railroads, including BCR, CN, CP, and SRY railroads, Daily Operating Bulletins (DOBs) are required. Review electronic mail for DOBs sent from foreign railroads and upon receipt, upload to the designated location identified in the Dispatcher Notice for train crew access.

54.4 Limits of Authority (CROR 82)

When issuing authority, limits must be defined using signal and station names. The use of mileposts, station name signs, and switches to define authority limits is prohibited.

Example: SBCS Townsend and NBCS Brownsville.

54.5.1 Authority to Pass Stop Signal (CROR 564)

Before issuing authority to pass a Stop signal (Box 2) on the Authority Form, do the following:

Note: Include a Box 3 if dual control switch(s) will be traversed. Circle SHALL NOT if the route is properly lined, and the dual control switch is lined and locked. Circle MUST if the route is NOT properly lined, or the dual control switch is out of correspondence.

- Apply track block(s) using the Pass Stop Indication (PSI) function in the control system.
- Track block(s) must be identified in the control system by entering the manually generated authority number (V number) and engine identification (Example: V-8101 BNSF 1234). Use the same V number in Box 1 on the Authority Form to identify the authority number.

Note: When authorizing a train past a Stop signal to enter their own Box 5 work authority under the same Authority Form, identify track block(s) with the track and time authority number and include engine identification with Box 2 (Example: V-471-45 BNSF 1234 Box 2).

- Do NOT verbally issue the PSI instructions from the control system prompt box.

Canceling Authority to Pass Stop Signal (CROR 569):

When a train has entered the track segment beyond the affected control point, the authority is considered fulfilled and may be automatically cancelled. Completion of the cancellation section on the Authority Form is NOT required.

The device block may be removed only if:

- An opposing signal route cannot be established into the affected track segment, or
- The train has cleared the affected track segment.

54.5.2 Locally-Controlled Interlocking Signal Indicating Stop (CROR 609)

Before issuing authority to pass a Stop signal (Box 2) at the locally-controlled interlocking signal located at Bridge 127 on the Authority Form, do the following:

- Job brief with Bridge 127 signalman about the move to be made. If there is no signalman on duty, notify the Signal Call Desk and NOC MW Help Desk and wait until a signalman is onsite.
- Apply track block(s) using the Pass Stop Indication (PSI) function in the control system.
- Track block(s) must be identified in the control system by entering the manually generated authority number (V number) and engine identification (Example: V-8101 BNSF 1234). Use the same V number in Box 1 on the Authority Form to identify the authority number.

Note: When authorizing a train past a Stop signal to enter their own Box 5 work authority under the same Authority Form, identify track block(s) with the track and time authority number and include engine identification with Box 2 (Example: V-471-45 BNSF 1234 Box 2).

- Do NOT verbally issue the PSI instructions from the control system prompt box.
- Include a Box 11 Other Specific Instructions on the Authority Form that states, "After authority received from Bridge 127 signalman."

Canceling Authority to Pass Stop Signal at Locally-Controlled Interlocking:

When a train has entered the track segment beyond Bridge 127, the authority is considered fulfilled and may be automatically cancelled. Completion of the cancellation section on the Authority Form is NOT required.

The device block may be removed only if:

- An opposing signal route cannot be established into the affected track segment, or
- The train has cleared the affected track segment.

54.5.3 Permission to Enter Main Track (CROR 568)

Before issuing permission to enter the main track (Box 4) on the Authority Form, do the following:

- Apply track block(s) using the Enter Controlled Track (ECT) function in the control system.
- Track block(s) must be identified in the control system by entering the manually generated authority number (V number) and engine identification (Example: V-8101 BNSF 1234). Use the same V number in Box 1 on the Authority Form to identify the authority number.
- Do NOT verbally issue the ECT instructions from the control system prompt box.

Canceling Permission to Enter Main Track (CROR 569):

When a train has entered the affected location, the authority is considered fulfilled and may be automatically cancelled. Completion of the cancellation section on the Authority Form is NOT required.

The device block must NOT be removed until one of the following conditions is met:

- The train crew has reported the train has entered the main track and is moving in the authorized direction, and the opposing signal route cannot be established into the affected location, or
- The train has cleared the affected location.

54.5.4 Work Authorities (CROR 566)

Work authorities (Box 5) are used to grant bidirectional authority for trains. Other train movements that require a work authority:

- Reverse Movement (CROR 573)
- Change of Direction within a Control Point (CROR 576)
- Multiple Changes of Direction within a Control Point (CROR 576)
- Permission for Switch on Hand (CROR 566.1)

Note: Granting a train permission to operate a switch on hand also requires a Box 6.

Before issuing a work authority on the Authority Form, do the following:

- Apply track block(s) using the track and time function in the control system.
- Do NOT verbally issue the track and time authority from the control system prompt box.
- Use the control system generated track and time number in Box 1 on the Authority Form to identify the authority number.

Canceling Work Authorities (CROR 569)

Once the train is ready to report clear, do the following:

- Verbally cancel the Authority Form to the train.
- Report clear of the track and time in the control system.
- Do NOT verbally report clear of the track and time using the control system prompt.

54.5.5 Joint Work Authorities (CROR 567)

Joint work authorities indicate overlapping limits with trains (Box 5 with a Box 7) or field employees (Box 5 with a Box 8 and/or Box 9). When placing track and time in the control system, issue the authority as "joint".

Note: CROR 567.1 allows only one train joint with field employees. The control system will NOT prompt a warning to prevent this from occurring.

When issuing a TOP, record all required information on the form provided. Authority must NOT be verbally issued until proper protection has been established. The (TOP) is available electronically through the Rules & TTs app and on the System Rules webpage.



Date: _____
mm/dd/yyyy

Track Release

Movement _____ is clear of _____ at _____
Engine Initial Number Location Time

Confirmed by Engineer _____
Name

Track Occupancy Permit – TOP – (for use in Canada Only)

☐ 1. TOP No. _____ to Foreman _____ at _____
(Employee In Charge)

☐ 2. Authority to work on _____ track

CROR 849

 between NBCS SBCS _____
 and NBCS SBCS _____

☐ 5. Behind _____ that has left _____ at _____
Engine Initial Number Direction Location Time

CROR 862

☐ 6. Overlaps TOP held by: _____

CROR 857

☐ 7. Other specific instructions: _____

This authority has: _____ boxes marked: _____
 Complete _____ RTC _____ Acknowledged by Frmn _____

Multiple Work Groups Using the Same Authority (Job briefing must be held with each work)

Work Group	Name	Acknowledgement Received	Time	Limits Cleared	Time
Work Group 1	Name	Acknowledgement Received	Time	Limits Cleared	Time
Work Group 2	Name	Acknowledgement Received	Time	Limits Cleared	Time
Work Group 3	Name	Acknowledgement Received	Time	Limits Cleared	Time

Cancellation

Are all employees and multiple work groups clear of the track(s)? ☐ yes, ☐ no

☐ 10. TOP No. _____ Cancelled at _____ RTC _____

Acknowledged by Frmn _____

Order No. 3009050777
Rev. Date: 10/15/2025

54.6.1 TOP Work Authorities (CROR 849)

Work authorities (Box 2) are used to grant bidirectional authority to field employees. Before issuing a TOP do the following:

- Apply track block(s) using the track and time function in the control system.
- Do NOT verbally issue the track and time authority from the control system prompt box.
- Use the control system generated track and time number in Box 1 on the TOP to identify the authority number.

Canceling TOP Work Authorities (CROR 864):

Once the field employee is ready to cancel the authority (Box 10), do the following:

- Verbally cancel the TOP to the field employee, by issuing a Box 10.
- Report clear of the track and time in the control system.
- Do NOT verbally report clear of the track and time using the control system prompt.

54.6.2 Joint TOP Work Authorities (CROR 857)

Joint work authorities (Box 5 with a Box 6) indicate overlapping limits with other field employees. When issuing track and time in the control system, issue the authority as “joint”

Note: The first joint TOP work authority does NOT require a Box 6. All subsequent joint authorities require a Box 6.

Note: The TOP does NOT have a field to indicate joint with a train. The Authority Form Box 8 and/or Box 9 identifies joint status with a field employee.

54.6.3 Follow-up TOP (Behind Train) (CROR 862)

Any time a field employee requests a work authority that overlaps a train's authority, all engine identifications must be included in the behind field of the track and time. In addition, a written track release must be completed, and a Box 5 must be included on the TOP.

Note: The practice of completing a track release and issuing a TOP authority without a Box 5 is NOT permitted.

54.7 Crossing Warning (CROR 103(g) and CROR 103.1)

When issuing a crossing warning notification, record the required information on the Canadian version of the Crossing Warning Notification form provided. Crossing warnings that need protection for an extended period may be issued on Form C to protect locations on main track or TCM to protect locations on other than main track. The Crossing Warning Notification (for use in Canada only) is available electronically through the Rules & TTs app and on the System Rules webpage.



Crossing Warning Notification

(for use in Canada only)

Date _____

INITIATE TRACK TAG BEFORE FILLING OUT FORM

Subdivision _____ D.O.T./T.C. # (if provided) _____ District No. _____

- ☐ 1. Automatic crossing warning device malfunctioning or activation failure or disabled at* MP _____
Stop and protect movement even if devices are seen to be working.
Proceed per CROR Rule 103(g). Number ** _____
- ☐ 3. Passive crossing warning device damaged or missing at* MP _____
Stop and protect movement. Proceed per CROR Rule 103(g).

Notified of crossing situation by _____ Time _____

Crossing situation remedied by _____ Time _____

Train	Location	OK Time	RTC

Retain and Archive regardless of whether delivered to train

* When issuing, include street name (when provided) and milepost location.

** TMDS Restrictive XING Tag Number. Not transmitted to the train crew.

[TOC Home](#)

55.0 Reserved for Future Use

56.0 Reserved for Future Use

57.0 Reserved for Future Use

58.0 Reserved for Future Use

59.0 Reserved for Future Use

60.0 Emergency Response Requirements

60.1 Emergency Events

It is our policy to treat emergency situations with the highest level of priority and emphasis in order to:

- Reduce potentially negative outcomes.
- Minimize personal suffering.
- Limit inconvenience and interruption to all concerned parties.

During emergency events the following instructions apply:

- Ascertain as much information from initial notifier as practical.
 - What emergency response equipment is needed? (Ex. ambulance, fire, police, etc.).
 - Are there any injuries to employees or non-BNSF individuals?
 - Did the emergency event occur at a crossing? What is the nearest railroad crossing or street to the emergency event?
 - Are hazardous material shipments involved?
 - Are any other tracks blocked?
 - Are other railroads or highways blocked?
 - Are there other adjacent railroads that could be affected?
 - What other threats exist, if any?
- Make note of key information such as:
 - Time event occurred.
 - Location(s) affected, including mile posts when possible.
 - Identification of involved train(s), equipment, and/or personnel.
- Secure the area of the emergency event from other train or equipment movements which could cause unnecessary interference or danger.
- Make telephone notification to the designated response desk(s) (ROCC / SID) as soon as possible. If unable to contact the designated response desk, notify the Chief Dispatcher or other designee. Once notified, the designated response desk will handle subsequent notifications.
- If the emergency event occurs at a crossing equipped with an automatic warning device (flashers or gates), promptly contact the Signal Call Desk after notifying the designated response desk. If the emergency event occurs at a crossing equipped with a passive warning device (crossbucks, yield sign, Stop sign, etc.) promptly contact the NOC MOW Help Desk after notifying the designated response desk.
- Resume normal operation only after obtaining approval from the Chief Dispatcher.

Instructions for Train Dispatchers Located in Dispatching Centers Outside of the NOC

If communication problems are experienced, such as a telephone outage, when attempting to contact the designated response desk, notify the Chief Dispatcher. The Chief Dispatcher will notify the Resource Operations Center who in turn will contact the Service Interruption Desk. In addition, the Chief Dispatcher will take necessary actions to establish a communication link with the Service Interruption Desk and notify them of the emergency.

60.1.1 Report to ROCC (BNSF Police) and Chief Dispatcher

Immediately report by telephone any of the following events to the ROCC (BNSF Police):

- All accounts of accidents or injuries requiring emergency responder assistance such as:
 - Ambulance/EMS.
 - Fire department.
 - Police.
- Trespasser(s) or unauthorized person(s) on BNSF rail, equipment, or property.
- Bomb/terrorism threat.
- Reports of suspicious activity on/near the track or BNSF property.
- Right of way fire(s).
- Near miss at a crossing (crossing warning device disregarded by pedestrian/vehicle).
- Livestock fatally injured by rail equipment.
- Passenger train reports of disruptive/unruly passenger(s) or those in need of medical assistance, etc.

Once the ROCC has been notified, notify the Chief Dispatcher.

All reports to the ROCC and Chief Dispatcher must include pertinent information such as time, location, and the identification of involved train(s), equipment, and/or personnel.

Unauthorized persons must not be permitted on equipment, except for emergency personnel performing necessary duties (ex. firefighters, police, medics, etc.). When emergency personnel must perform necessary duties on equipment, instruct a qualified employee to attend the equipment until:

- Emergency personnel duties no longer require them to be on, under or between the equipment.
- The qualified employee inspects the equipment for proper securement and confirms that equipment is secured.

When notified that unauthorized persons are on, under or between unattended equipment, notify the ROCC. Additionally, notify the Chief Dispatcher to coordinate prompt arrival of a qualified employee, such as a crew member, Spvr Road Operations, Spvr Road & Train Operations, etc., to inspect the train or cars for proper securement.

60.1.2 Report to Service Interruption (SID) and Chief Dispatcher

Immediately report by telephone any of the following events to the Service Interruption (SID) Desk:

- All accounts of accidents or derailments where emergency responders (Police, Fire, EMS) are not needed.
- Damaged or leaking rail cars.
- Damaged or leaking hazardous commodities.
- Serious accidents involving the integrity of the block system.
- Near collisions between on-rail equipment.
- Any unusual occurrence involving on-rail equipment which does not require emergency responders.

All reports to the SID and Chief Dispatcher must include pertinent information such as time, location, and the identification of involved train(s), equipment, and/or personnel.

60.1.3 Hazardous Materials

Immediately report any cars or containers of hazardous commodities that are damaged, leaking, or involved in a derailment to the appropriate Chief Dispatcher and the Service Interruption Desk. If hazardous materials are involved in a fire, immediately report the condition to the ROCC (BNSF Police) and appropriate chief dispatcher.

Be familiar with and understand the use of hazardous material inquiry programs. Examples of these programs in TSS include:

- DTRS (with "Hazardous" set to "Y") for train lists.
- PRTTRK (with "Hazardous" set to "Y") for track lists.
- HAZMENU (list includes the traditional "HAZ" for obtaining emergency response information as well as HAZCAR for obtaining description of the hazmat contents of a car or intermodal unit along with others—STCC, HAZUNNA & more.)
- HMCHK to run a check for correctness of hazmat placement in a train.

60.2 Earthquake Instructions for Train Dispatchers in Addition to System Special Instructions

After contacting all affected trains as required by System Special Instructions, the train dispatcher must then contact the following:

- Chief Dispatcher.
- Resource Operation Center.
- Signal Call Desk.
- Service Interruption Desk.

Note: Service Interruption Desk (SID) contact is only necessary when the BNSF weather service provider does not include epicenter and magnitude information in the earthquake broadcast. If this is the case, the SID will contact the National Earthquake Information Center (NEIC) for this information. The SID will also contact all state and government agencies that require notification.

60.3 Serious Accidents Involving the Integrity of the Block System

It is our policy to provide the opportunity for the FRA to participate in joint tests with our signal personnel in cases where a serious accident (fatality or collision) occurs and the integrity of the block system may be implicated or involved. In such cases, the following instructions apply:

- Immediately stop train movements in the area of the accident by any means available when a report of a serious accident is received and the integrity of the block system may be implicated or involved.
- Immediately report the accident to the Service Interruption Desk after train movements in the area are known to be restricted.

When CTC or manual interlockings are involved, approval from the General Superintendent Transportation or the Region Vice President Transportation must be obtained prior to any change to existing signal indications or switch positions, whether changed by the train dispatcher or field employee.

- The Service Interruption Desk will immediately notify the appropriate managers (Operating and Signal) to seal the signal equipment associated with the accident.
- The Manager Signals will be responsible for notifying the local FRA inspector of the accident, advising him/her that the signal equipment has been sealed pending their arrival to participate in a joint inspection of the signal system.
- All train and engine crew members and any other employees involved should be interviewed as soon as possible to develop their knowledge of the accident with respect to the function of the involved signal system.
- The Manager Signals will be responsible for having signal personnel available to perform required tests on the signal equipment.

Signal maintenance personnel are not to be called unless approved by the Manager Signals.

If the Manager Signals is not available, the Supervisor of Signals for the territory where the accident occurs will be responsible.

60.4 Reserved for Future Use

60.5 Positive Protection

When an ROCC member needs access to work between standing rail cars or locomotives, they will establish Positive Protection with the Employee in Charge (EIC) per System Special Instructions Item 14.

If the EIC cannot establish communication with the locomotive engineer, the EIC will contact the train dispatcher.

The train dispatcher must:

- Determine whether the rail equipment is planned to be moved.
- Apply a track block on the track segment of the rail equipment labeled with the EIC's name.
- Confirm Positive Protection is established with the EIC.
- Remove track block only after the EIC reports "in the clear".

60.6 ROCC Request for Traffic Stop

When the Resource Operations Call Center (ROCC, BNSF Police) requests a traffic stop, the following actions are required:

- Notify closely approaching trains and instruct them to stop short of the indicated location.
- Notify MW employees with authority in the immediate vicinity.
- Apply track blocks or restrictive tags to prevent movement into the area.
- Make a general broadcast in the area where the traffic stop was requested and repeat this broadcast at least once.

Example: BNSF XXXX Dispatcher, General Broadcast, local authorities request train traffic be stopped at MP XX.X due to XXXX.

- Hold train traffic until notified by the ROCC that it is ok to resume operations.